

AD-A156 492


NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS  
LAKE WAUKEWAN DAM (NH.) (U) CORPS OF ENGINEERS WALTHAM  
MA NEW ENGLAND DIV OCT 78


1/1

UNCLASSIFIED

F/G 13/13

NL

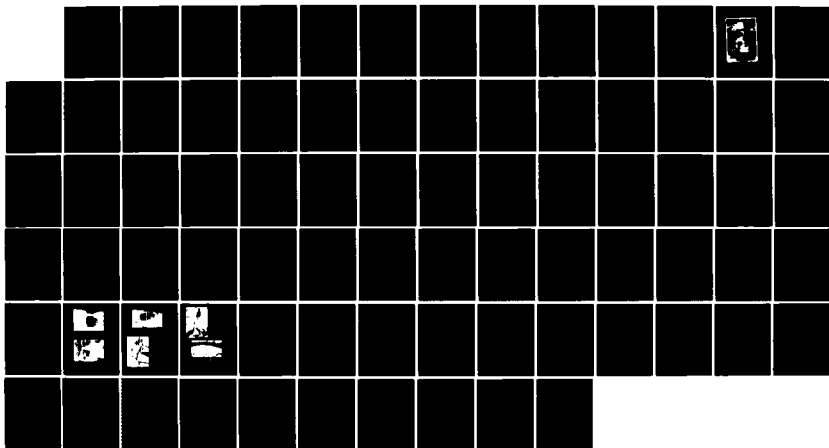

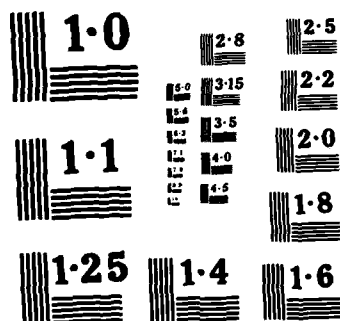


NATIONAL BUREAU OF STANDARDS  
MICROCOPY RESOLUTION TEST CHART

AD-A156 492

MERRIMACK RIVER BASIN  
MEREDITH, NEW HAMPSHIRE

LAKE WAUKEWAN DAM  
NH 00306


PHASE I INSPECTION REPORT  
NATIONAL DAM INSPECTION PROGRAM

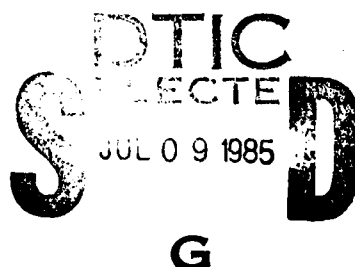

DEPARTMENT OF THE ARMY  
NEW ENGLAND DIVISION, CORPS OF ENGINEERS  
WALTHAM, MASSACHUSETTS, 02154

OCTOBER 1978

DTIC FILE COPY

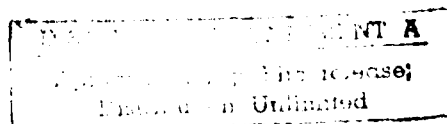

85 06 17 013

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER NH 00306	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Lake Waukewan Dam NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS		5. TYPE OF REPORT & PERIOD COVERED INSPECTION REPORT
7. AUTHOR(s) U.S. ARMY CORPS OF ENGINEERS NEW ENGLAND DIVISION		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS		8. CONTRACT OR GRANT NUMBER(s)
11. CONTROLLING OFFICE NAME AND ADDRESS DEPT. OF THE ARMY, CORPS OF ENGINEERS NEW ENGLAND DIVISION, NEDED 424 TRAPELO ROAD, WALTHAM, MA. 02254		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE October 1978
		13. NUMBER OF PAGES 53
		15. SECURITY CLASS. (of this report) UNCLASSIFIED
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) APPROVAL FOR PUBLIC RELEASE: DISTRIBUTION UNLIMITED		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Cover program reads: Phase I Inspection Report, National Dam Inspection Program; however, the official title of the program is: National Program for Inspection of Non-Federal Dams; use cover date for date of report.		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) DAMS, INSPECTION, DAM SAFETY, Merrimack River Basin Meredith New Hampshire Man made outlet between Lake Waukewan and Lake Winnepesaukee		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) The dam is a man made outlet facility between lake Waukewan and Lake Winnepesaukee. The dam is on fair condition as a result of a modification completed in 1976. Further hydrological studies are required to establish the need for, and means, of providing an emergency spillway.		

## **DISCLAIMER NOTICE**

**THIS DOCUMENT IS BEST QUALITY  
PRACTICABLE. THE COPY FURNISHED  
TO DTIC CONTAINED A SIGNIFICANT  
NUMBER OF PAGES WHICH DO NOT  
REPRODUCE LEGIBLY.**

LAKE WAUKEWAN DAM

NH 00306

Accession For	
NTIS GRA&I	<input checked="checked" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A/1	23 1/1

MERRIMACK RIVER BASIN  
MEREDITH, NEW HAMPSHIRE



PHASE I INSPECTION REPORT  
NATIONAL DAM INSPECTION PROGRAM

PHASE I REPORT  
NATIONAL DAM INSPECTION PROGRAM

Name of Dam: Lake Waukegan Dam, I.D. NH 00306  
State Located: New Hampshire  
County Located: Belknap  
Town Located: Meredith  
Stream: Man made outlet between Lake Waukegan and  
Lake Winnepesaukee  
Date of Inspection: June 6, 1978

BRIEF ASSESSMENT

Lake Waukegan Dam is a man-made outlet facility between Lake Waukegan and Lake Winnepesaukee. The facility, a surge and outlet structure has a total overflow weir length of only 11.25 feet with a permanent crest elevation of 1.80 feet below the nominal lake level.

The physical condition of the facility is fair as a result of a modification completed in 1976. It is to be noted that there is no dam or impounding structure associated with this facility. Lake Waukegan Dam has created an additional outlet between Lake Waukegan and Lake Winnepesaukee; however, the original natural outlet has fallen into disuse and has been effectively blocked, so that at present all hydraulic conveyance is through Lake Waukegan Dam. The only provisions for emergency spillage is through the regulating weir, which has very limited capacity. The project has approximately 4 feet of surcharge storage capacity equivalent to 4 in. of runoff or about 20 percent of Probable Maximum Flood Volume (PMF), the recommended test flood for this project. Lake inflows in excess of storage capacity could overtop the lake rim and flood streets of Meredith. Further hydrologic studies are required to establish the need for, and means, of providing an emergency spillway.

Recommended actions to be carried out by the owner, within 12 months after receipt of this Phase I Report, are summarized in Section 7. The most important of these is the acquisition of sufficient data to produce a comprehensive set of drawings for the facility from its inlet canal to the outlet channel into Lake Winnepesaukee. Foundation conditions along the waterway are to be determined in conjunction with this task. A further study to augment the existing hydraulic conveyance capacity between Lake Waukegan and Lake Winnepesaukee is recommended.

Robert Gershowitz, P.E.



This Phase I Inspection Report on Lake Waukegan Dam has been reviewed by the undersigned Review Board members. In our opinion, the reported findings, conclusions, and recommendations are consistent with the Recommended Guidelines for Safety Inspection of Dams, and with good engineering judgment and practice, and is hereby submitted for approval.

---

CHARLES G. TIERSCH, Chairman  
Chief, Foundation and Materials Branch  
Engineering Division

---

FRED J. RAVENS, Jr., Member  
Chief, Design Branch  
Engineering Division

---

SAUL COOPER, Member  
Chief, Water Control Branch  
Engineering Division

APPROVAL RECOMMENDED:

---

JOE B. FRYAR  
Chief, Engineering Division

## PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation, and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that unsafe condition be detected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aide in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

## TABLE OF CONTENTS

	Page
TRANSMITTAL LETTER	i
BRIEF ASSESSMENT	ii-iii
REVIEW BOARD SIGNATURE SHEET	iv
PREFACE	v
TABLE OF CONTENTS	vi-vii
OVERVIEW PHOTO	viii
LOCATION MAP	ix
REPORT	
<u>SECTION 1 - PROJECT INFORMATION</u>	
1.1 General	1
1.2 Description of Project	2
1.3 Pertinent Data	6
<u>SECTION 2 - ENGINEERING DATA</u>	
2.1 Design	9
2.2 Construction	9
2.3 Operation	10
2.4 Evaluation	10
<u>SECTION 3 - VISUAL INSPECTION</u>	
3.1 Findings	11
3.2 Evaluation	15
<u>SECTION 4 - OPERATION PROCEDURES</u>	
4.1 Procedures	16
4.2 Maintenance of Dam	16
4.3 Maintenance of Operating Facilities	16
4.4 Description of any Warning System in Effect	17
4.5 Evaluation	17
<u>SECTION 5 - HYDRAULIC/HYDROLOGIC</u>	
5.1 Evaluation of Features	18
<u>SECTION 6 - STRUCTURAL STABILITY</u>	
6.1 Evaluation of Structural Stability	21


## TABLE OF CONTENTS

(Continued)

	Page
<u>SECTION 7</u> - ASSESSMENT, RECOMMENDATIONS AND REMEDIAL MEASURES	
7.1 Dam Assessment	23
a. Condition	
b. Adequacy of Information	
c. Urgency	
d. Need for Additional Investigations	
7.2 Recommendations	24
a. Data Acquisition	
b. Investigation	
7.3 Remedial Measures	25
a. Alternatives	
b. O&M Maintenance and Procedures	

## APPENDICES

APPENDIX A	CHECKLISTS - VISUAL OBSERVATIONS	
	- ENGINEERING, CONSTRUCTION MAINTENANCE DATA	1-14
	- SUMMARY OF ENGINEERING DATA	15
APPENDIX B	PHOTOGRAPHS	
APPENDIX C	PLATES	
	PLANS & DETAILS OF DAM - Drawings 1 & 2	
	GEOLOGICAL MAP Drawing 3	
APPENDIX D	HYDROLOGIC COMPUTATIONS	1-13
APPENDIX E	INFORMATION AS CONTAINED IN THE NATIONAL INVENTORY OF DAMS	

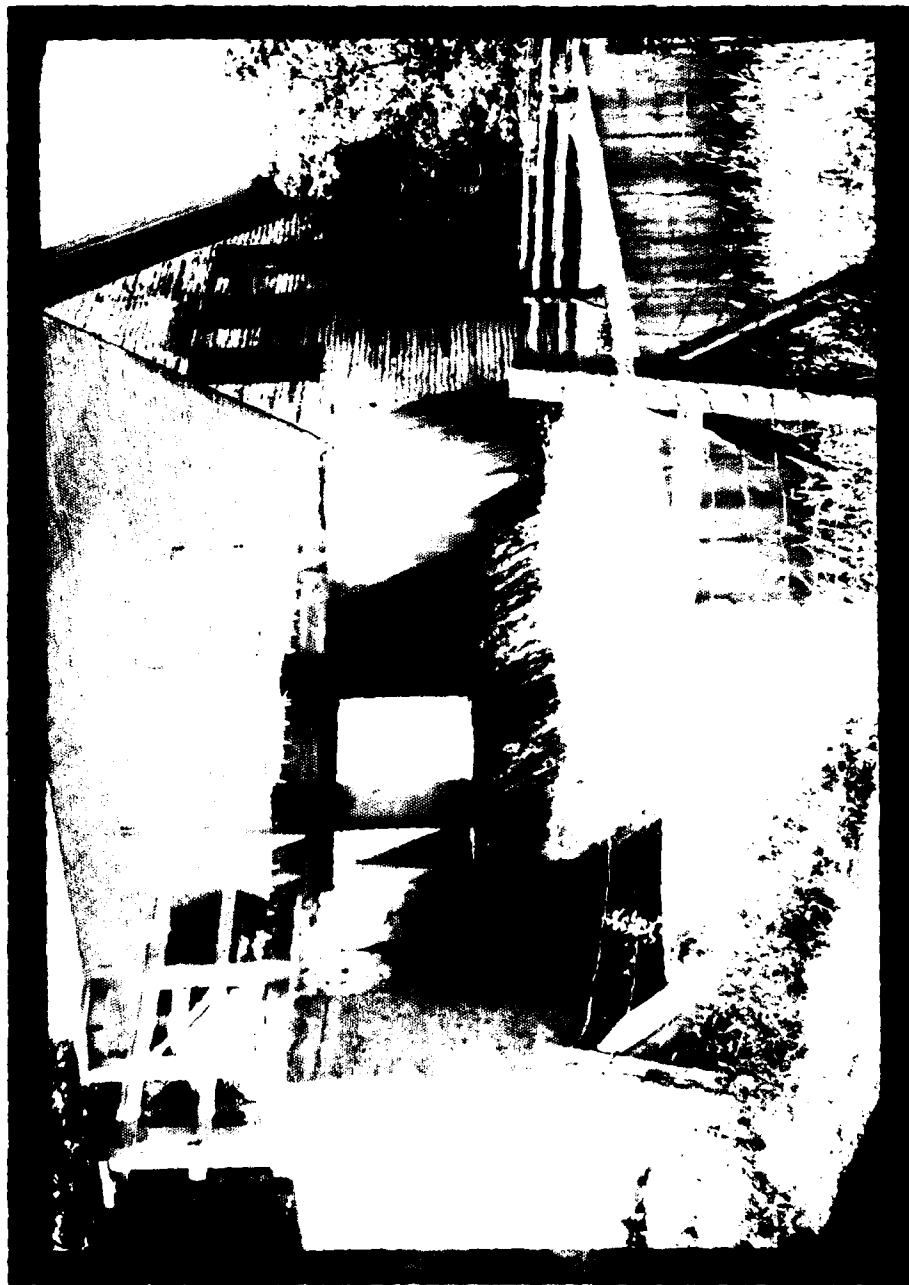

L A K E   W A U K E W A N   D A M

View of the surge and overflow structure in the Amatex Corporation parking area



VICINITY MAP

Quadrangle: Holderness, N.H.  
Scale: 1:62,500

PHASE I INSPECTION REPORT  
LAKE WAUKEWAN DAM NH 00306

SECTION 1  
PROJECT INFORMATION

1.1 General

a. Authority. Public Law 92-367, August 8, 1972, authorized the Secretary of the Army, through the Corps of Engineers, to initiate a national program of dam inspection throughout the United States. The New England Division of the Corps of Engineers has been assigned the responsibility of supervising the inspection of dams within the New England Region. HARRIS-ECI ASSOCIATES has been retained by the New England Division to inspect and report on selected dams in the State of New Hampshire. Authorization and notice to proceed was issued to HARRIS-ECI ASSOCIATES under a letter of June 7, 1978 from Ralph T. Garver, Colonel, Corps of Engineers. Contract No. DACW 33-78-C-0305 has been assigned by the Corps of Engineers for this work.

b. Purpose

(1) Perform technical inspection and evaluation of non-Federal dams to identify conditions which threaten the public safety and thus permit correction in a timely manner by non-federal interests.

(2) Encourage and assist the States to initiate quickly effective dam safety programs for non-federal dams.

(3) To update, verify and complete the National Inventory of Dams.

## 1.2 Project Description

### a. Location

Lake Waukewan Dam is located on the grounds of the Amatex Corp. in the Town of Meredith, Belknap County, New Hampshire. The facility is located between Lake Waukewan and Lake Winnepesaukee, east of Main Street and North of Dover Street. Lake Waukewan is a tributary to Lake Winnepesaukee and part of the Merrimack River primary drainage basin.

### b. Description of Dam and Appurtenances

Lake Waukewan Dam is a man-made outlet facility between Lake Waukewan and Lake Winnepesaukee that was used formerly for power generation but has not been used for that purpose since 1954. There is no actual dam or impounding structure connected with the facility; instead Lake Waukewan, a natural lake, was used as the reservoir. No plans or drawings are on file for any part of this facility. Reference is made to Drawing 2 which shows the schematic layout of the scheme as made on the visual inspection. The natural outlet of Lake Waukewan is Corliss Brook but its outlet channel has been effectively blocked by a road and other parts of its natural channel have been filled by private interests, apparently with the tacit approval of the Town.

The present facility was constructed in 1904 and consists of an intake canal approximately 700-foot long and about 20-foot wide running from Lake Waukewan to a point some 60 feet west of Main Street. At this point, a concrete culvert said to be 6 x 6 feet in dimension connects the water to 6-foot diameter steel conduit and from there to a surge and overflow structure. Flow in the conduit and penstock can be shut-off by means of a manually operated timber sluice gate. The surge and overflow structure was used as the inlet to the penstock of a hydraulic turbine and served as a surge overflow facility at load rejection and as the regulating weir controlling the level of Lake



Waukegan when power was not being generated. The penstock inlet was walled off in 1976 when the surge and overflow structure was remodeled to increase its overflow capacity. As of now the total overflow weir length is only 11.25-foot long with a permanent crest elevation of 1.80 feet below the nominal lake level of Elevation 539.0.

The surge and outlet structure is located on Amatex Corporation property and discharges into an outlet channel. The channel runs down a steep hillside alongside and below adjacent Amatex mill buildings, discharging into Lake Winnepesaukee some 200 feet to the east of and 35 feet below the surge and outlet structure. There are no other buildings nearby or affected by the outlet channel.

Lake Waukegan has a surface area of 947 acres and impounds 20,540 acre-feet of water derived from a tributary drainage area of 12.54 square miles.

c. Size Classification

According to the "Recommended Guidelines of the Safety Inspection" by U.S. Department of the Army, Office of the Chief of Engineers, the facility is classified in the size category as being "Intermediate" since its storage is more than 1,000 acre-feet, but less than 50,000 acre-feet. Since there is no dam, its size is not classifiable in the usual manner. The overall size classification is based on the storage capacity alone, and accordingly the facility is classified as being "Intermediate" in size.

d. Hazard Classification

The facility has been classified as having a High Hazard Potential in the Inventory of Dams compiled by U.S. Army Corps of Engineers on the basis that excessive damage could occur to downstream property in the

event of failure of the facility and its appurtenances, together with the possibility of losing more than a few lives. This inspection concurs with the assessment on the basis that the facility impounds a very large volume of water, and that at present Lake Waukegan has its natural outlet blocked off, and relies solely on the artificial outlet created by the former power waterway to regulate lake levels. The outlet capacity of the Amatex Corporation waterway is very inadequate to accommodate and pass along flood inflows into Lake Waukegan and could pose a threat to downstream mill property and to mill employee's life in case of a very large storm inflow event.

e. Ownership

Lake Waukegan Dam is owned by the Amatex Corporation of Meredith, New Hampshire.

f. Operator

Lake Waukegan Dam is operated by the Amatex Corporation, Daniel Webster Highway, Meredith, New Hampshire.

g. Purpose of Dam

The facility at present is only used to regulate the level of Lake Waukegan although in former times, up to 1954, it was used to generate power for mill operation purposes.

h. Design and Construction History

No records exist for the design and construction history. The facility was built in 1904, according to available documentation, and was used for the next 50 years for mill power generation. Lake level regulation was incidental to power generation and the various mill owners undertook this task as part of their normal operations. In 1954, the power generation at the site ceased, but the regulation of the lake level has continued by the mill owner. As a result of the active regulation of

the lake by the various mill owners, the natural outlet of Lake Waukegan fell into disuse and the conveyance capacity of its natural channel has been seriously impaired by the construction of a town road crossing its channel at the lake rim and by filling operations along its channel length by a lumber company. As a result, the natural outlet, called Corliss Brook has no significant capacity to pass flood water inflows from Lake Waukegan to Lake Winnepesaukee, and the entire hydraulic conveyance capacity between both lakes is now at Lake Waukegan Dam. After power generation ceased, the power penstock flow was no longer available as part of the hydraulic conveyance, and accordingly the N.H. Water Resources Board (NH-WRB) ordered the owner to increase the capacity of the overflow weir section. The reconstruction of the surge and overflow structure was completed in 1976. The main feature of this work was to lower permanent overflow crest by 18 in. and the relining of the interior of the structure with a reinforced concrete wall which permanently blocked off the power penstock.

i. Normal Operating Procedures

At present, the level of Lake Waukegan is being regulated by the Amatex Corporation by means of stop planks in the surge and overflow structure. The normal lake level is being maintained at Elev. 539± in the summer time, and 15 to 22 inches lower in the winter time, corresponding to 3 stop planks in place at the outlet structure weir in the summer time and zero to one stop planks in the winter.

### 1.3 Pertinent Data

a. Drainage Area 12.54 square miles

b. Discharge at Dam Site

Maximum known flood at dam site: ( Volume unknown, occurred on 7/4/78.  
( Lake level rose 3 ft. above normal.

Warm water outlet at pool elevations: NA

Diversion tunnel low pool outlet at pool elevation: NA

Diversion tunnel outlet at pool elevation: NA

Gated spillway capacity at pool elevation: NA

Gated spillway capacity at maximum pool elevation: NA

Ungated spillway capacity at maximum pool elevation: 530 cfs, all stop planks removed

Total spillway capacity at maximum pool elevation: 530 cfs, all stop planks removed

c. Elevation (Feet above MSL)

Top of dam: Not applicable, no dam exists. Minimum lake rim level estimated at 543.08

Maximum pool design surcharge: Elev. 543.08

Full flood control pool: NA

Recreation pool: Elev. 539

Spillway crest: ( Permanent crest 537.20 of overflow structure

Upstream portal invert diversion tunnel: NA

Downstream at centerline diversion tunnel: NA

Streambed at centerline of dam: NA

Maximum tailwater: Normal level of Lake Winnepesaukee  
Elev. 504.0

d. Reservoir

Length of maximum pool: 2.76 miles  
Length of recreation pool: 2.76 miles  
Length of flood control pool: NA

e. Storage (acre-feet)

Recreation pool: 20,542  
Flood control pool: NA  
Design surcharge: 24,500  
Top of dam: NA

f. Reservoir Surface (acres)

Top of dam: NA  
Maximum pool: 1,003 (Elev. 543.0)  
Flood control pool: NA  
Recreation pool: 947 (Elev. 539.0)  
Spillway crest: 947 (Elev. 539.0)

g. Dam

Type: )  
)  
Length: )  
)  
Height: )  
) No dam exists at the site, the  
Top width: ) former power waterway is used  
Side Slopes - Upstream: ) presently for lake level  
- Downstream: ) regulation  
Zoning: )  
)  
Impervious core: )  
)  
Cutoff: )  
)  
Grout curtain: )

h. Diversion and Regulating Tunnel

Type: NA  
Length: NA  
Closure: NA  
Access: NA  
Regulating facilities: NA

i. Spillway

Type: Surge overflow structure  
Length of weir: 11.25 feet  
Crest elevation: 537.20 permanent concrete crest plus  
4 flashboards, each 7 1/2 in. high  
Gates: None  
U.S. Channel: 6-foot diameter penstock  
D/S Channel: Outlet chute channel, masonry  
construction

. Regulating Outlets

Low level outlet: None  
Controls: None  
Emergency gate: Timber sluice gate in power waterway,  
manually operated under balanced head  
conditions  
Outlet: 6-foot diameter penstock

SECTION 2  
ENGINEERING DATA

2.1 Design

There are no plans for any part of this facility, whether for parts built originally in 1904 or sections reconstructed in 1976. A reconnaissance sketch of the schematic layout of the facility is shown on Drawing 2. There is no design information available on the subsurface conditions along the outlet water waterway.

No information is available on the hydraulic capacity of the rebuilt surge and overflow structure as it stands today, although computations for a previously considered modification are in the files of N.H. Water Resources Board (NH-WRB).

No information is available for the hydrologic basis of the original power waterway design and the lake level regulation capability of that design.

No information is available on the structural design of the various components of the facility. The location of interface between the concrete conduit and the steel penstock cannot be identified in the field. The exact location and dimensions of the power waterway cannot be verified from any documented source or any physical evidence on the ground.

2.2 Construction

No data of any kind has been recovered on the construction of the facility.

### 2.3 Operation

No data has been recovered on the operation of the facility insofar as regulation of the lake level. The lake level has risen to approx. 3 ft. above its nominal level in 1933, 1936 and 1973. The 1973 event apparently was the most severe, in that outflows from the surge and overflow structure weir overtopped the small retaining wall at the top of the chute outlet channel and threatened to undermine the foundations of the adjacent Amatex mill buildings as well as the outlet structure itself and its outlet chute channel.

### 2.4 Evaluation

#### a. Availability

Engineering data and documentation of the physical features of Lake Waukewan Dam are virtually non-existent. A program of data acquisition and documentation is required.

#### b. Adequacy

The lack of in-depth engineering data did not allow for a definitive review. Therefore, the adequacy of this dam could not be assessed from the standpoint of reviewing design and construction data, but is based on visual inspection, past performance history and sound engineering judgment.

#### c. Validity

Available data in the form of inspection reports and dam records in the files of the NH-WRB are inconsistent and need to be reassessed and evaluated against an actual record set of as-built drawings and details.



SECTION 3  
VISUAL INSPECTION

3.1 Findings

a. General

Lake Waukegan Dam is in fair physical condition after a rehabilitation completed in 1976. Although a significant part of the waterway could not be inspected due to prevailing head water conditions, the operable portions, such as the sluice gate and stop planks appeared to be in acceptable working condition.

b. Dam

There is no dam associated with this facility.

c. Appurtenances (refer to Drawing 2)

The appurtenant structures that make up the waterway of this facility are:

- (1) The intake canal intake structure and intake culvert section.
- (2) The penstock section including the sluice gate house.
- (3) The surge and overflow structure.
- (4) The outlet chute channel.

Intake Structure and Intake Culvert Section. The intake structure is at the end of a 700-ft. long intake channel which is approx. 20-ft. wide and 6.5-foot deep. The channel is apparently man made and leads off a narrow bay of Lake Waukegan adjacent to Water Street. The intake canal

at places was lined with brush and trees, but the vegetation probably does not affect its hydraulic conveyance capacity. At the end of the canal, some 60 feet east of Main Street, a concrete intake structure has been built. The intake is a widened section of the intake culvert, and the mouth of the intake is guarded by a wooden trash screen with bars spaced about 6 inches on centers vertically. The intake leads to a concrete culvert said to be 6 feet by 6 feet in dimension which could not be inspected. This concrete culvert passes under the building fronting on the west side of Main Street, and then crosses Main Street itself. The condition of the conduit is deteriorated according to town officials interviewed during the inspection, and is thought to be the source of leakage water within the bed of Main Street. On the west side of Main Street, the concrete conduit is terminated at an undefined point and the waterway continues in a 6-foot diameter metal penstock pipe.

Penstock Pipe. No part of the penstock pipe was visible or accessible for inspection since it runs underground at an undefined location. The general path of the pipe is westward toward the Amatex Corp. plant. In the parking lot of the Amatex Corp. a gate house has been built, housing a timber gate whose function is to cut off the water flow in the penstock for the maintenance of downstream portions. The gate is not considered an emergency structure, since it cannot be quickly lowered against flowing water. The invert of the waterway is believed to be approximately 8 feet below the top of the ground at the gate house.

The gate itself is constructed of timber and has two 8 in. x 12 in. timber gate stems. Both stems are used in raising or lowering the gate. Each stem has a cast iron rack spiked to it. These racks are driven by two pinion gears which are both keyed to the same shaft. On each end of the shaft, there is a hub with a number of sockets into which

a lever can be placed. Two men, one at each hub, operate the gate. In addition, there is a ratchet and pawl at each end of the pinion shaft which can be used to lock the gate in any desired position.

There is a one-foot diameter shear gate installed on the upstream face of the sluice gate. This shear gate is used to flood the downstream portion of the penstock pipe leading to the stop log structure after dewatering for maintenance. In this manner, the differential head across the sluice gate is eliminated and the effort required to raise the gate is reduced. The gate appeared to be in satisfactory operating condition, having been rebuilt in 1976.

The gate house walls are of reinforced concrete construction. No leakage water or wet ground conditions were observed at the gate house structure. The gate house superstructure was of wood construction with siding and has a conventional roof covered with asphaltic sheet roofing material. The gate house was in acceptable condition.

Surge and Overflow Structure. The waterway reach between the gate house and the overflow structure is also a buried 6-foot diameter steel penstock according to information received from the owner's representatives. This reach was not visible or accesible for inspection. No traces of ground seepage could be detected visually that could be attributed to the pipe. The surge and overflow structure is of concrete construction and used to serve as a surge facility during turbine load rejection, and as an overflow facility when the turbine was shut-down or when inflows exceeded turbine's water demand. The concrete structure was relined on the inside with a 15-inch facing layer of concrete during the 1976 rehabilitation of the facility. The inside resurfacing has permanently blocked off the 6-foot diameter power penstock leading to the hydraulic turbine at the mill. Some of the outside surfaces of the surge and overflow structure are in a cracked and deteriorated condition, but no immediate corrective action is required at this time since the inside surfaces have been relined.

At the same time as the relining work was completed, the permanent spillway crest was lowered to a point 1.5 feet below the normal level of Lake Waukewan, and a three bay stop plank section was added above the permanent crest. The stop log planks are supported by steel angle supports at the wall ends, and by intermediate structural steel beams in between. The vertical steel beams are in very good condition. The stop planks are also considered in good condition although some planks deflected visibly under the water pressure. No action is required now, but if the deflection becomes sufficient to cause significant leakage between planks, the planks should be replaced.

At the time of the inspection, three stop log planks were in place in each of the three bays, and 6 inches of water was flowing over the top of the planks. The loss of head in the waterway from the intake to the stop planks was estimated at one inch.

Outlet Channel Chute. The water passing over the stop planks of the surge and overflow structure passes into a narrow chute channel that drops steeply down a hillside slope. The channel is variously pitched and has drops of several feet between sections. The construction is mainly masonry walls and masonry or grouted stone bottom, but there are concrete paved and formed sections as well. The entire drop is estimated at 35 feet. At the bottom of the slope, the outlet channel is widened to accommodate the turbine tailrace. The widened channel passes under an Amatex mill building and U.S. Route 3 in a concrete culvert before entering Lake Winnepesaukee, the receiving body. The chute wall adjacent to the surge and overflow structure was rebuilt and raised in the 1976 reconstruction to prevent a spillover condition at high discharges that threatened the safety of the Amatex building during the 1973 flood event.

The entire chute channel and walls are in acceptable condition; however, the hydraulic performance during high flow conditions cannot be evaluated due to lack of configuration data.

Geologic Setting. The entire waterway facility is believed to be founded on either a bouldery ground moraine or granite bedrock. No exposures of subsurface material occur in Meredith adjacent to the facility.

d. Reservoir

The reservoir rim is generally flat to moderately sloping for the first 5 to 6 feet above the full lake level and moderately sloping above that. The lake rim is naturally wooded, with local clearings where summer cottages or residences have been constructed. No signs of reservoir rim instability could be visually detected.

e. Downstream Channel

The downstream channel is a very short open channel leading from the culvert exit on the west side of U.S. Route 3 to Lake Winnepesaukee. There are no obstructions or residences in this reach.

3.2 Evaluation

The overall physical condition of the facility is judged fair for the portion that could be visually inspected. The intake culvert and steel penstock could not be inspected and no evaluation of their condition is possible. The owner should review his records and files of the 1976 reconstruction for possible condition reports of these structures or obtain reliable eyewitness statements from personnel present at that time.

SECTION 4  
OPERATIONAL PROCEDURES

4.1 Procedures

Lake Waukegan Dam is currently operated solely for the purpose of regulating the level of Lake Waukegan. The regulation of the lake is carried out by the personnel of the Amatex Corporation, the owners of the facility. The facility is not the natural outlet of Lake Waukegan. The natural outlet of Lake Waukegan is Corliss Brook, located one half mile south of the Lake Waukegan Dam near the intersection of Waukegan Street and Railroad Avenue. The channel of Corliss Brook has been partially blocked by the reconstruction of Waukegan Avenue in 1922. Downstream parts of the natural brook channel have been filled in by a lumber company. As a result, the natural outlet plays no role in regulating Lake Waukegan surface levels or in conveying water from Lake Waukegan to Lake Winnepesaukee, the receiving body.

The level of Lake Waukegan is maintained at or near Elevation 539.0 in the summer months and the lake is drawn down 22 to 30 inches below the summer level in the winter months to minimize ice damage and to provide storage for spring-time snowmelt inflows.

4.2 Maintenance of the Dam

Maintenance of the facility is carried out on an as-needed basis by personnel of the Amatex Corporation.

4.3 Maintenance of Operating Facilities

At the time of inspection, the facility appeared to be adequately maintained. The trash rack at the inlet was free of debris, the sluice

gate was adequately protected inside the gate house and the outlet channel chute was free of obstructions and debris. Maintenance is provided on an as-needed basis by the owner.

#### 4.4 Description of any Warning System in Effect

There is no warning system in effect. The outlet channel chute is on the property of the Amatex Corporation, in the immediate vicinity of the facility. The only property not belonging to Amatex is the short reach of the outlet culvert under U.S. Route 3 and the short connecting channel to Lake Winnepesaukee.

#### 4.5 Evaluation

The operational procedures at the facility are simple fitting in with the simple facilities involved. In line with greater public interest in dam safety, the owner should institute a bi-annual dam inspection utilizing a simplified version of the visual check list used in this inspection report. The reports should be kept on permanent file. Maintenance schedules should be drawn up and all visits to the facility should be logged in a permanent record, whether for maintenance or operation.

SECTION 5  
HYDRAULIC/HYDROLOGIC

5.1 Evaluation of Features

a. Design Data

The evaluation of the hydraulic and hydrologic features of Lake Waukegan Dam was based on criteria set forth in the Corps' Guidelines for Phase I inspections, and additional guidance provided by the New England Division, Corps of Engineers. The Probable Maximum Flood (PMF) was estimated from guide curves for probable maximum flood for New England region, based on past Corps' studies. The PMF peak versus drainage area curves are presented in the section of hydrologic computations.

The PMF curve applicable for rolling areas was adopted for the estimation of the PMF peak of the reservoir. The PMF versus drainage area relationship can be expressed mathematically as follows:

$$Q = 2323 - 676.99 \log_{10} A$$

$$Q_p = Q \times A$$

where:

$$Q = \text{Unit peak discharge in cfs, square miles}$$

$$Q_p = \text{Peak PMF discharge, in cfs, for the watershed of the dam}$$

$$A = \text{Watershed area, in square miles, upstream of the dam axis.}$$



The computed peak discharge of the PMF for a drainage area of 12.54 square miles using the above equation is 19,806 cfs. A triangular shaped flood hydrograph was assumed for the inflow design hydrograph.

The PMF inflow hydrograph was routed through the reservoir by the modified Puls Method, utilizing computer program HEC-1. The peak outflow discharge for the PMF is 9,796 cfs. The PMF results in overtopping of the lake rim,

The overtop discharge rating curve was developed by assuming an overflow section 300-foot long with a top elevation of 543.08. This corresponds physically to the intake canal bank reach upstream of the intake structure. The canal bank would overflow and discharge lake water into Main Street at times of high levels caused by large lake inflows. There could also be other lake rim reaches where lake water might overflow such as at the natural outlet in the vicinity of Railroad Avenue. No detailed survey information was available to delineate other potential natural overflow areas along the lake rim.

The reservoir stage-capacity curve was constructed using comparisons of both dam inventory data and planimetered areas, measured from 15 minute quadrangle topography maps. Reservoir storage capacity included surcharge levels exceeding the rim of the lake at the intake canal. In the routing computations, the discharge through outlet facilities was excluded on the basis that its capacity was insignificant in comparison with the PMF. The overtop discharge rating curve and the reservoir capacity curve are presented in the section of hydrologic computations.

b. Experience Data

The most recent severe rainstorm occurred on July 4, 1973, and raised the lake level 3 feet above normal, not enough to top the banks of the intake canal. At that time, the surge and overflow structure permanent crest was 18 inches above its present level, and the resulting large

flow out of the surge and overflow structure jumped over the training wall of the outlet chute channel and started to erode the hillside adjacent to the Amatex mill buildings. The flow was brought under control by sandbagging the area around the surge and overflow structure and re-training the flow toward the outlet channel. Other high flow events occurred in 1933 and 1936 according to records in the files of the NH-WRB.

c. Visual Observations

The spillway outlet channel is very narrow with relatively low masonry walls. The hydraulic capacity and energy dissipation properties cannot be assessed without a detailed profile along its length. The intake canal rim can act as an auxiliary spillway, routing lake flows into and down Main Street adjacent to it. The hydraulic capacity of the surge and overflow structure is very limited and the intake structure could be subject to clogging at critical times.

d. Overtopping Potential

As indicated in Section 5.1.a., the PMF, when routed through Lake Waukegan results in overtopping of the lake rim at the intake canal surcharge capacities are too small to accommodate the peak flow. The PMF overtopped the lake rim by 4.9 feet. This figure is indicative only and must be modified on the basis of a more accurate survey of reaches of the lake rim subject to overtopping during high lake levels. According to the Recommended Guidelines for Inspection of Dams by the Corps of Engineers, the lake should have an outlet capable of handling the PMF. The question of whether the outlet capacity should be at the Lake Waukegan Dam facility owned by Amatex Corporation or at the formal natural outlet at Corliss Brook cannot be answered within the scope of this investigation. At present the Lake Waukegan has inadequate outlet discharge capacity. The existing surge and overflow structure has a capacity of approximately 5 percent of the PMF before overtopping of the lake rim occurs.

No dam break calculations were performed since there is no artificial impounding structure associated with the facility.

SECTION 6  
STRUCTURAL STABILITY

6.1 Evaluation of Structural Stability

a. Visual Observations

The present condition of the facility suggests a stable structure to all outward appearances. Allegations that the intake culvert is leaking could not be verified visually, and should be further investigated if strong evidence of leakage is present. The outlet channel chute has a very limited waterway cross section and could be subject to overtopping and undermining during large lake outflows. This channel, however, has withstood all flows since the facility was opened for operation in 1904. It should be noted that the 1976 reconstruction markedly increases the possible flows in this channel, and its stability and hydraulic action should be reviewed together.

b. Design and Construction Data

No design or construction data was uncovered that would permit the evaluation of stability of the facility.

c. Operating Records

Even though the facility is changed from the configuration standing during the 1973 flood, the performance at that time casts some doubts on the ability of the surge and overflow structure to survive a PMF event. Questionable conditions relate to the foundation of the surge and overflow structure and its possible loss due to progressive slope erosion downhill of the structure.

d. Post Construction Changes

The 1976 rehabilitation improved the ability of the facility to prevent lake rim overtopping during medium frequency storm events. The modification of the surge and overflow structure increased the conveyance capacity of the entire waterway to make up for the loss of conveyance by the permanent walling off of the power penstock. The increased discharge capacity of the surge and overflow structure might overtax the hydraulic capacity of the outlet channel chute.

e. Seismic Stability

The dam is located in Seismic Zone 2 and, in accordance with the Recommended Phase I Guidelines, does not warrant seismic analyses.

## SECTION 7

### ASSESSMENT, RECOMMENDATIONS AND REMEDIAL MEASURES

#### 7.1 Dam Assessment

##### a. Condition

The overall physical condition of Waukegan Lake Dam is fair as a result of its modification completed in 1976. The facility has an inadequate outflow capacity amounting to approximately 5 percent of the spillway Design Flood (SDF) for this watershed, which in this case is the Probable Maximum Flood (PMF). The spillway discharge capacity has been estimated by current Corps of Engineers screening criteria, and the owner should determine the spillway capacity by more sophisticated and accurate methods and procedures.

##### b. Adequacy of Information

The lack of in-depth engineering data did not allow for a definitive review. Therefore, the adequacy of this dam could not be assessed from the standpoint of reviewing design and construction data, but is based primarily on visual inspection, past performance history and sound engineering judgment.

##### c. Urgency

The urgency of performing the recommendations and remedial measures are detailed below.

##### d. Need for Additional Investigations

There is no need for further investigations in this phase of the program. Recommended investigations to be carried out by the owner are listed below.

## 7.2 Recommendations

It is recommended that the owner, within 12 months after receipt of this Phase I Report, assemble the following information, if the data can be found:

### a. Data Acquisition

(1) An updated as-built set of drawings of the facility showing all pertinent details of the complete waterway from the head of the inlet canal to the outlet at Lake Winnepesaukee.

(2) A topographic survey of the overbank area of the inlet canal should be part of the survey. The area around the natural outlet of the lake should also be topographically surveyed. All topographic and condition surveys should be tied into a common U.S.G.S. datum system.

(3) The foundation conditions along the waterway should be determined and depth to bedrock indicated where less than 10-foot deep.

### b. Investigations

Determine the spillway capacity of the dam using more sophisticated and accurate methods than were used in the Phase I screening methodology employed in this report. These studies should include the routing of the inflow through the lake, based on the accurate elevation of low lying lake rim areas that could act as overflow sections during high lake levels.

Reevaluate the hydraulic capacity of the outlet chute channel at the Spillway Design Flood (SDF) discharge conditions and reassess the possibility of undermining this part of waterway and the adjacent surge and overflow structure at SDF discharges.

It is also recommended that the owner formulate a plan for conveying the SDF from Lake Waukegan to Lake Winnepesaukee utilizing the Lake Waukegan Dam conveyance, and other possible conveyance routes.

Based on the results of the spillway capacity analyses, the owner should formulate plans for augmenting the Lake Waukegan spillway capacity, if shown necessary.

### 7.3 Remedial Measures

#### a. Alternatives

The alternatives available for augmenting the outlet capacity of Lake Waukegan are as follows:

- (1) Increase the outlet capacity at Lake Waukegan Dam owned by Amatex Corporation.
- (2) Restore the outlet capacity at Corliss Brook.
- (3) Develop a new outlet for Lake Waukegan at a third site.
- (4) Seasonally lower the level of Lake Waukegan to provide additional storage for large inflows.
- (5) Use a combination of all four alternatives listed above.

Based on the final formulated plan for conveyance of the SDF between Lake Waukegan and Lake Winnepesaukee, the owner should review the adequacy of the Lake Waukegan Dam to safely convey its stipulated share of the total flow requirements.

b. O&M Maintenance and Procedures

The owner should initiate the following programs:

(1) A bi-annual inspection of the dam utilizing a visual check list similar to that used in this inspection report.

(2) Set up a maintenance schedule and log all visits to the dam for operation, repairs and maintenance.

(3) Assemble and keep on hand complete documentation of the dam design, as-built drawings, and any other data pertaining to the dam safety.

(4) The owner should establish a formal system with local officials for warning downstream residents in case of emergency. Round the clock surveillance should be provided by the owner during periods of unusually heavy precipitation.



APPENDIX A

- CHECK LISTS: - VISUAL OBSERVATIONS
- ENGINEERING, CONSTRUCTION  
MAINTENANCE DATA
- HYDRAULIC AND HYDROLOGIC DATA  
ENGINEERING DATA

CHECK LIST  
VISUAL INSPECTION  
PHASE 1

Name Dam LAKE WAUKEWAN DAM County Belknap State New Hampshire Coordinators                     

Date(s) Inspection June 6, 1978 Weather Sunny Temperature 75°F

Pool Elevation at Time of Inspection 539.6 ± M.S.L. Tailwater at Time of Inspection 504.0 ± M.S.L.

Inspection Personnel:

Seymour Roth  
David Kerkes  
Yin Au-Yeung

Lynn Brown  
William Flynn

Recorder: Seymour M. Roth

Representing the Owner: Mr. Fred Copp, Amatex Corporation

Also interviewed: Mr. Donald Jutton, Town Manager, Town of Meredith  
Mr. Harold Wyatt, Selectman, Town of Meredith

# CONCRETE/MASONRY DAMS

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS AND RECOMMENDATIONS
SEEPAGE OR LEAKAGE	Note: There is no dam associated with this facility.	
STRUCTURE TO ABUTMENT/EMBANKMENT JUNCTIONS	NA	
DRAINS	NA	
WATER PASSAGES	NA	
FOUNDATIONS	NA	

# CONCRETE/MASONRY DAMS

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
SURFACE CRACKS CONCRETE SURFACES	NA	
STRUCTURAL CRACKING	NA	
VERTICAL & HORIZONTAL ALIGNMENT	NA	
MONOLITH JOINTS	NA	
CONSTRUCTION JOINTS	NA	

# EMBANKMENT

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
SURFACE CRACKS	NA	
UNUSUAL MOVEMENT OR CRACKING AT OR BEYOND THE TOE	NA	
SLOUGHING OR EROSION OF EMBANKMENT AND ABUTMENT SLOPES	NA	
VERTICAL & HORIZONTAL ALIGNMENT OF THE CREST	NA	
RIPRAP FAILURES	NA	

# EMBANKMENT

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
JUNCTION OF EMBANKMENT AND ABUTMENT, SPILLWAY AND DAM	NA	
ANY NOTICEABLE SEEPAGE	NA	
STAFF GAGE AND RECORDER	NA	
DRAINS	NA	

# OUTLET WORKS

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS & RECOMMENDATIONS
CRACKING & SPALLING OF CONCRETE SURFACES IN OUTLET CONDUIT	<ol style="list-style-type: none"> <li>1. Some of the exterior surfaces of the surge and spillway shaft are cracked. The interior surfaces have been resurfaced with a layer of reinforced concrete.</li> <li>2. The surfaces of intake concrete structure are in acceptable condition.</li> <li>3. Exterior surfaces of the gate house were in acceptable condition</li> <li>4. The interior surfaces of the gate house and the intake conduit could not be inspected.</li> </ol>	No action required.
INTAKE STRUCTURE	<p>The intake structure consists of a widened section of a concrete conduit approximately 6 ft.-6 in. deep by 13.5 ft. wide leading to the 6 x 6 ft. concrete conduit under a house fronting on Main Street. The intake is protected by a wood trash rack with bars arranged vertically on 6 in. centers. The intake structure is at the end of 15-20 ft. wide canal leading in from Lake Waukegan. At a point east of Main Street, the 6 x 6 ft. culvert changes to a 6 ft. diameter penstock pipe. The penstock is controlled by a timber sluice gate. All visible portions of the intake were in acceptable condition.</p>	
OUTLET STRUCTURE (SURGE I OVERFLOW STRUCTURE)	<p>The outlet structure has been relined internally with new concrete but the outside upstream end is cracked. Three stop plank sections control the level of Lake Waukegan. The stop planks and guides are in good condition.</p>	
OUTLET CHANNEL	<p>The outlet channel is very steep and narrow dropping some 35 ft. on about 70 ft. horizontally. The upper part, adjacent to the surge overflow structure is protected by a 4.5 ft. high splash wall. The chute walls are in acceptable condition, constructed of various types of concrete and masonry.</p>	
EMERGENCY GATE	<p>The emergency gate is in the reach between the canal intake and the surge and overflow structure. The gate is of timber construction with a double timber stem. The stems have a cast iron toothed rack bolted to them. The gate is lifted manually by means of of pinch bars and pawls, one tooth at a time. The timber sluice gate and all appurtenances are new and in good working condition.</p>	

# UNGATED SPILLWAY

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS AND RECOMMENDATIONS
CONCRETE WEIR	NA	
APPROACH CHANNEL	NA	
DISCHARGE CHANNEL	NA	
BRIDGE AND PIERS	NA	



# GATED SPILLWAY

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS AND RECOMMENDATIONS
CONCRETE SILL	NA	
APPROACH CHANNEL	NA	
DISCHARGE CHANNEL	NA	
BRIDGE AND PIERS	NA	
GATES & OPERATION EQUIPMENT	NA	

# INSTRUMENTATION

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS AND RECOMMENDATIONS
MONUMENTATION/ SURVEYS	NA	
OBSERVATION WELLS	NA	
WEIRS	NA	
PIEZOMETERS	NA	
OTHER	NA	

# RESERVOIR

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS AND RECOMMENDATIONS
SLOPES	Lake Waukewan shore line is moderately sloping to flat and wooded except where locally cleared for residences. No instability of the shore line slopes could be detected.	
SEDIMENTATION	Some sedimentation is visible in the inlet canal but not enough to affect hydrological or hydraulic parameters.	

# DOWNSTREAM CHANNEL

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS AND RECOMMENDATIONS
CONDITION (OBSTRUCTIONS, DEBRIS, ETC.)	Very steep man made channel between surge and overflow structure and Lake Winnepesaukee, the receiving body. Chute bottom is concrete, walls are masonry or concrete. The chute masonry and concrete are in acceptable condition.	
SLOPES	Part of the channel slopes are extremely steep, 1 on 2 vertical.	
APPROXIMATE NUMBER OF HOMES AND POPULATION	Two Amatex mill buildings are located downstream of the surge and overflow structure; one is alongside the downstream channel, the other over the channel at the bottom of the slope.	

CHECK LIST  
ENGINEERING DATA  
DESIGN, CONSTRUCTION, OPERATION

ITEM	REMARKS
PLAN OF DAM	Not available. No dam actually exists.
REGIONAL VICINITY MAP	Available
CONSTRUCTION HISTORY	Available
TYPICAL SECTIONS OF DAM	Not available
HYDROLOGIC/HYDRAULIC DATA	Some available in N.H. Water Resources Board files
OUTLETS - PLAN	)
- DETAILS	)
- CONSTRAINTS	)
- DISCHARGE RATINGS	)
RAINFALL / RESERVOIR RECORDS	)
	Data on rebuilt overflow weir capacity is available
	Some data available in N.H. Water Resources Board files

CHECK LIST  
ENGINEERING DATA  
DESIGN, CONSTRUCTION, OPERATION  
(continued)

ITEM	REMARKS
DESIGN REPORTS	Not available
GEOLOGY REPORTS	Not available
DESIGN COMPUTATIONS HYDROLOGY & HYDRAULICS DAM STABILITY SEEPAGE STUDIES	Not available Some outlet weir computations are available } Not available
MATERIALS INVESTIGATIONS BORING RECORDS LABORATORY FIELD	} } Not available }
POST-CONSTRUCTION SURVEYS OF DAM	None performed
BORROW SOURCES	Not applicable
SPILLWAY PLAN - SECTIONS - DETAILS	} } Not available }

CHECK LIST  
ENGINEERING DATA  
DESIGN, CONSTRUCTION, OPERATION  
(continued)

ITEM	REMARKS
OPERATING EQUIPMENT PLANS AND DETAILS	Not available
MONITORING SYSTEMS	None installed
MODIFICATIONS	Surge and outlet structure remodeled in 1975
HIGH POOL RECORDS	Available in N.H. Water Resources Board files
POST CONSTRUCTION ENGINEERING STUDIES AND REPORTS	Not made
PRIOR ACCIDENTS OF FAILURE OF DAM - DESCRIPTION - REPORTS	) ) Not available )
MAINTENANCE OPERATION RECORDS	None available

CHECK LIST  
HYDROLOGIC AND HYDRAULIC DATA  
ENGINEERING DATA

Name of Dam: LAKE WAUKEWAN DAM

Drainage Area Characteristics: 12.54 square miles

Elevation Top Normal Pool (Storage Capacity): 539.0 (20,542)

Elevation Top Flood Control Pool (Storage Capacity): NA

Elevation Maximum Design Pool: 543.0 (2,500)

Elevation Top Dam: No dam exists. Minimum lake rim estimated at Elev. 543

SPILLWAY CREST:

a. Elevation Permanent crest 537.20

b. Type Triple pass stop-plank section

c. Width Approximately 3.5 feet

d. Length 11.3 feet

e. Location Spillover At top of slope Amatex property

f. No. and Type of Gates None

OUTLET WORK:

a. Type NA

b. Location NA

c. Entrance Inverts NA

d. Exit Inverts NA

e. Emergency Draindown Facilities None

HYDROMETEOROLOGICAL GAGES:

a. Type None

b. Location

c. Records

MAXIMUM NON-DAMAGING DISCHARGE 220 cfs (estimated)



APPENDIX B

PHOTOGRAPHS

ALL PHOTOGRAPHS TAKEN ON JUNE 6, 1978

LAKE WAUKEWAN DAM



Photo 1 - View of Lake Waukewan from the head of the inlet canal.



Photo 2 - End of the intake canal west of Main Street. The trash rack guarding the inlet of the 6 ft. x 6 ft. intake conduit passes under the building in the background and under Main Street, fronting on the building's other side.

LAKE WAUKEWAN DAM



Photo 3 - Gate house astride the 6-ft. diameter penstock. The gate inside is of timber construction, and can block off water for downstream maintenance.



Photo 4 - View of the double stem timber sluice gate lifting mechanism.

LAKE WAUKEWAN DAM



Photo 5 - The chute channel downstream of the surge and overflow structure (refer to overview photo). The total drop is about 35 feet.




Photo 6 - View of the outlet to Lake Winnepesaukee. The culvert runs under U.S. Route 3 and the Amatex Corporation mill building in the background.

APPENDIX C

PLATES


PLANS & DETAILS OF DAM  
GEOLOGIC MAP

Drawings 1 & 2  
Drawing 3

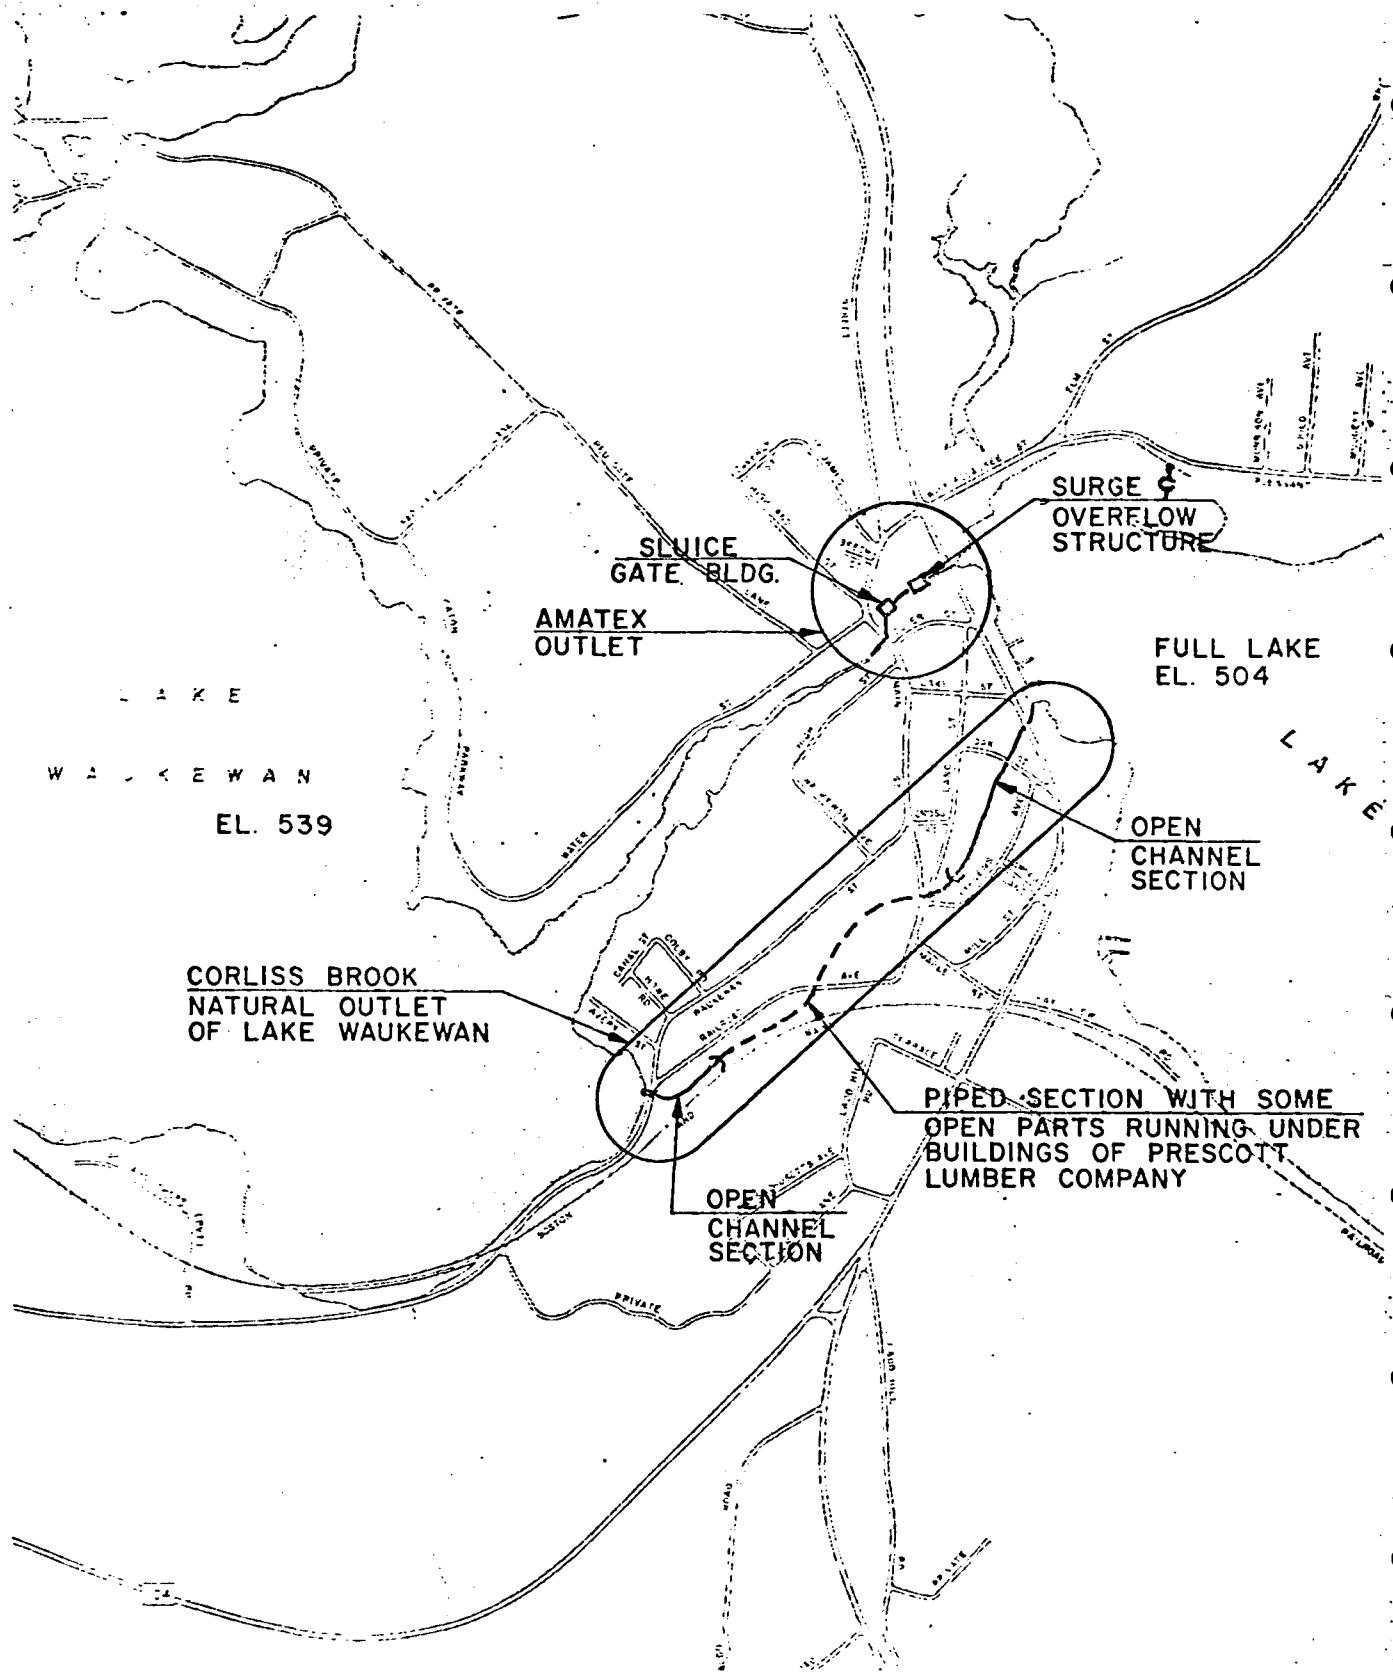

HARRIS - ECI ASSOCIATES	
LAKE WAUKEGAN	DWG. 1
LAKE OUTLET	

14205-101 A66004723  
14205-101 A66004723

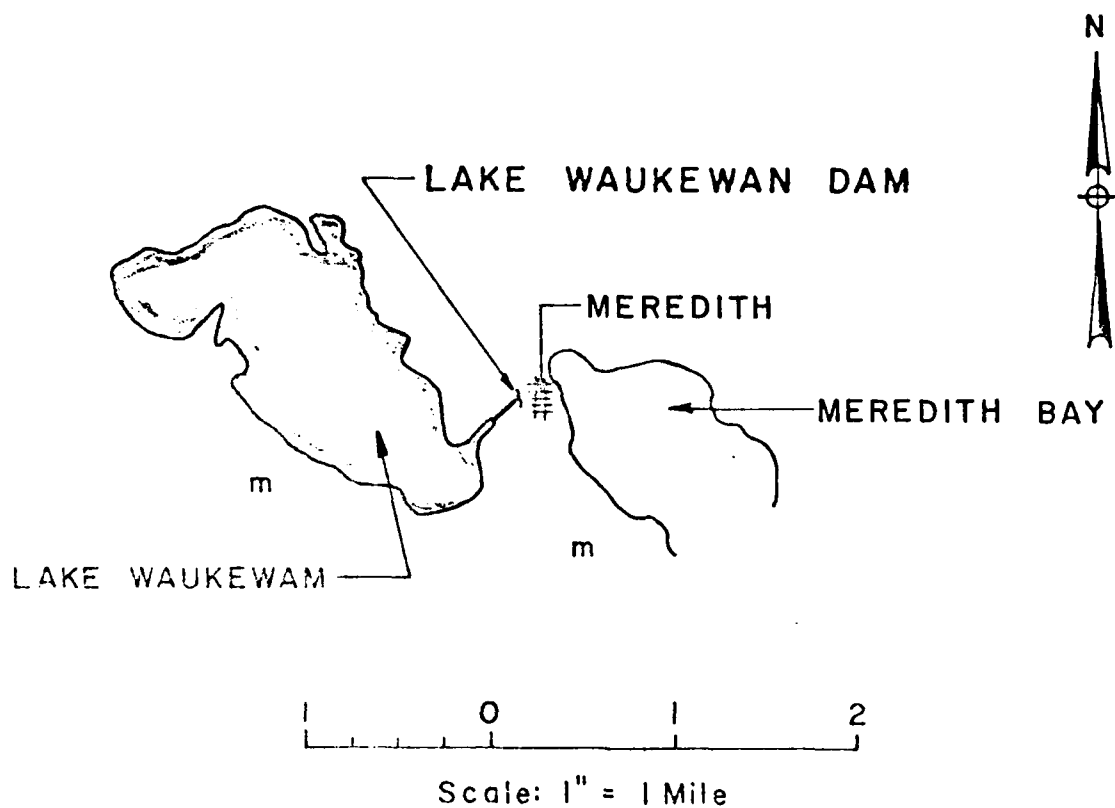

LEGEND:

- m Ground Moraine (Till)
- Contact

- NOTES: 1. No Outcrops Observed in Vicinity of Dam
2. Bedrock is a Porphyritic Granitic Gneiss and is Mantled by a Veneer of Moraine


GEOLOGIC MAP  
LAKE WAUKEWAN DAM

DWG. NO. 3



APPENDIX D

HYDROLOGIC COMPUTATIONS

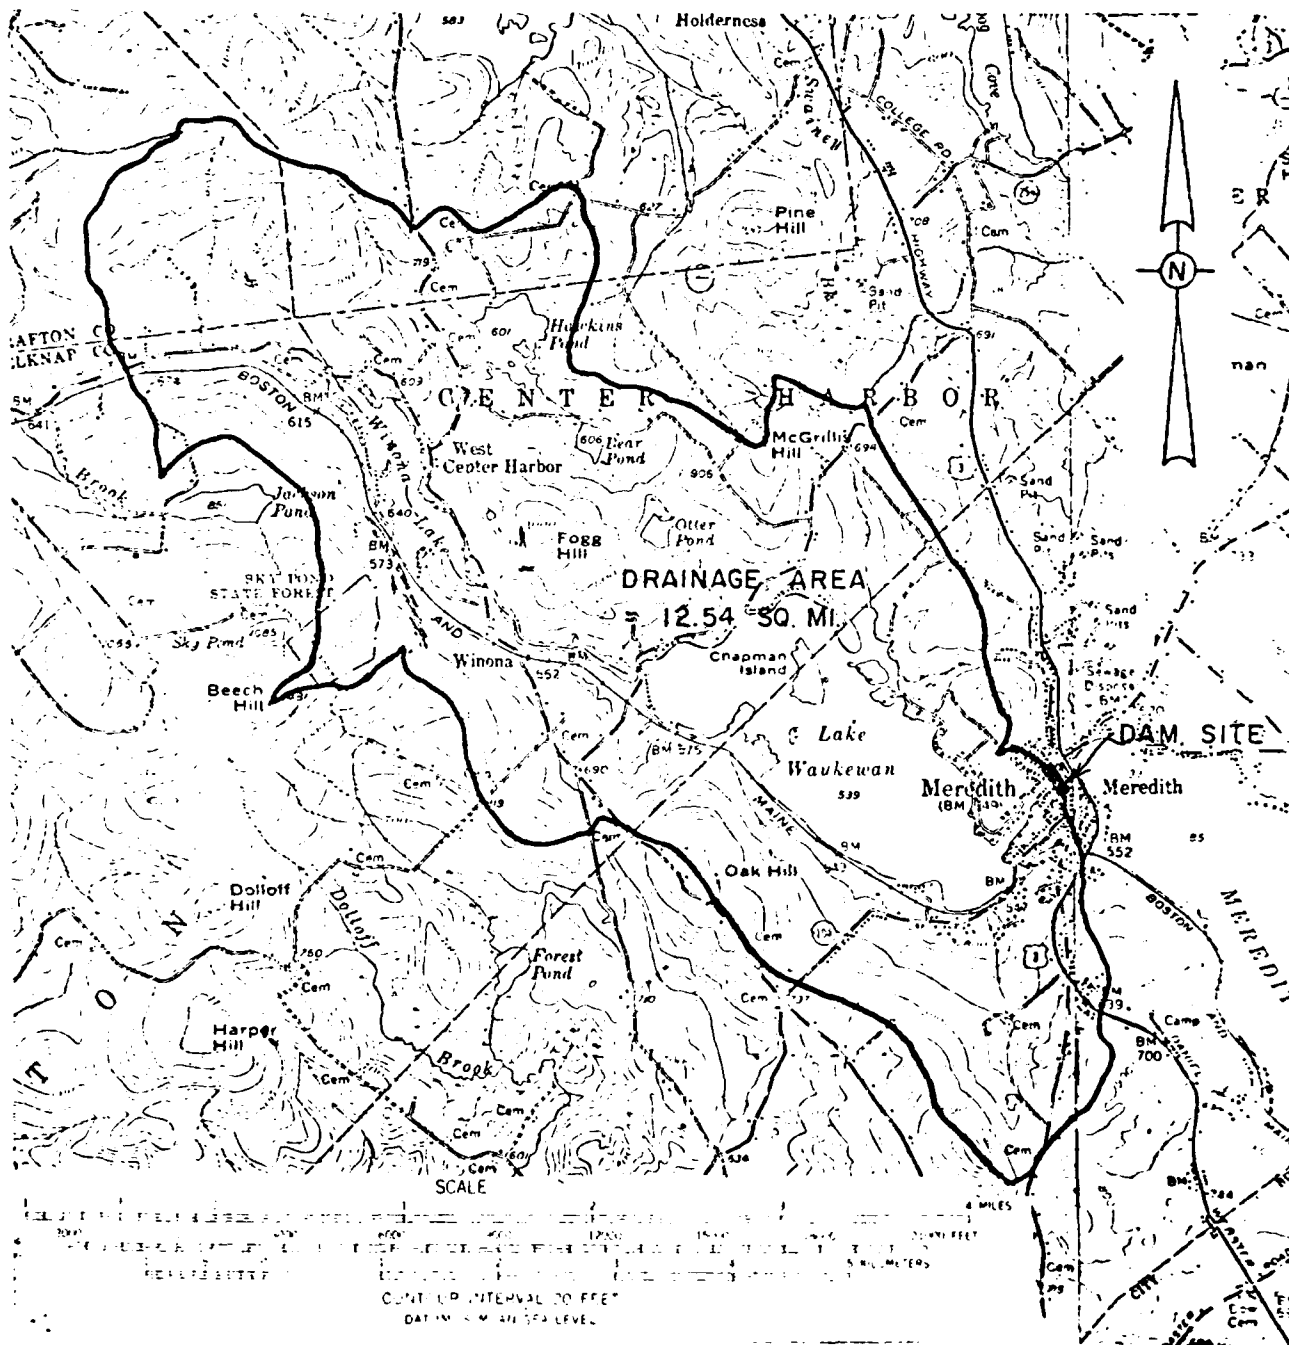

LAKE WAUKEWAN DAM  
DRAINAGE BASIN

NEW HAMPSHIRE DAM SAFETY III SECTION

SHEET NO. \_\_\_\_\_ OF \_\_\_\_\_

LAKE WAUKEWAN DAM

JOB NO. \_\_\_\_\_

RESERVOIR AREA CAPACITY DATA

BY \_\_\_\_\_ DATE \_\_\_\_\_

WAUKEWAN LAKE DAMRESERVOIR AREA CAPACITY DATA

MAXIMUM STORAGE = 24,500 AF EL = 543.06 FT

NORMAL STORAGE = 20,542 AF EL = 539 FT


RESERVOIR SURFACE AREA = 9.72 ACRES

AT AN ELEV OF 539 FT

ELEVATION FT	RESERVOIR AREA ACRES	RESERVOIR VOLUME AC-FT	REMARKS
539	9.72	20,542	
543	10.02	24,440	
543.06	10.03	24,500	
543.08	10.03	24,520	
543	10.25	25,453	

NO. 10000

3

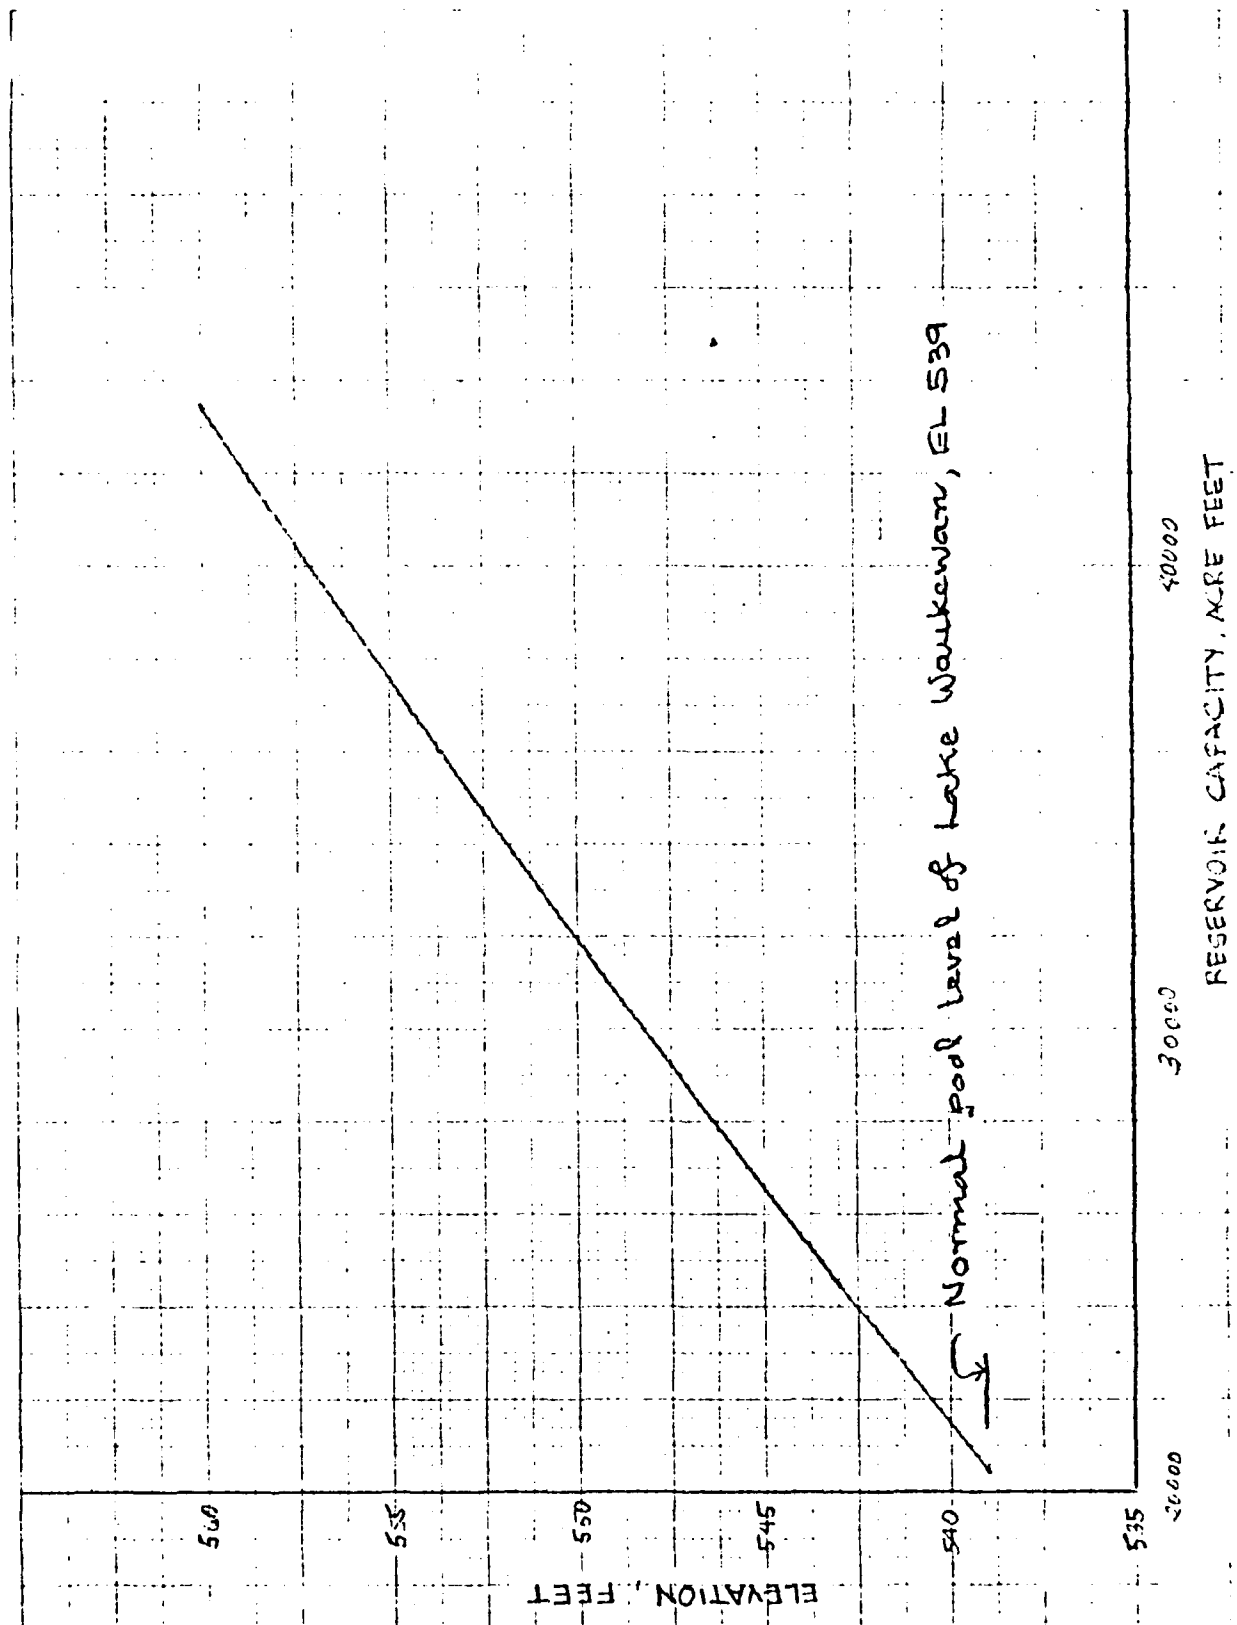

LAKE WAUKEGAN DAM  
RESERVOIR CAPACITY CURVE

NEW HAMPSHIRE DAM SAFETY INSPECTION

SHEET NO. 1 OF

LAKE WAUKEWAN DAM

JOB NO. 1211-001

OVERTOP RATING CURVE

BY MAZ DATE 8/10/


LAKE WAUKEWAN DAMOVERTOP RATING CURVE

ASSUME THE FOLLOWING:

1. An overflow section of 300' long
2. Assume  $C = 3.23$  in the formula.

$$Q = CLH^{3/2}$$

3. Assume top of overflow section  
at 543.03

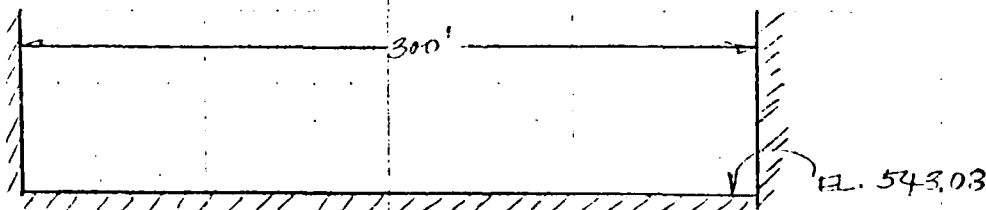

ELEV. OF OVERFLOW SECTION

1001 HALLMARK LINA BAYVIEW PORTLAND

SHEET NO. 2 OF


LATE WASHINGTON STATE

JOB NO. 1711 00

PERIOD: 1910-1915

BY S.M.S. DATE 9

ELEV. FEET	HEAD ON overflow Section	H	Q	L	Q = $2LH^{3/2}$
545.08	0	0			0
544.08	1	1	3.03	5.00	90.9
545.07	2	2	5.03	5.00	257.1
546.07	3	3	8.03	5.00	472.5
547.07	4	4	8.03	5.00	727.2
548.07	5	5	8.03	5.00	1016.3
549.07	6	6	8.03	5.00	1332.0
550.07	7	7	8.03	5.00	1685.5
551.05	8	8	8.03	5.00	2087.8
552.05	9	9	8.03	5.00	2547.5

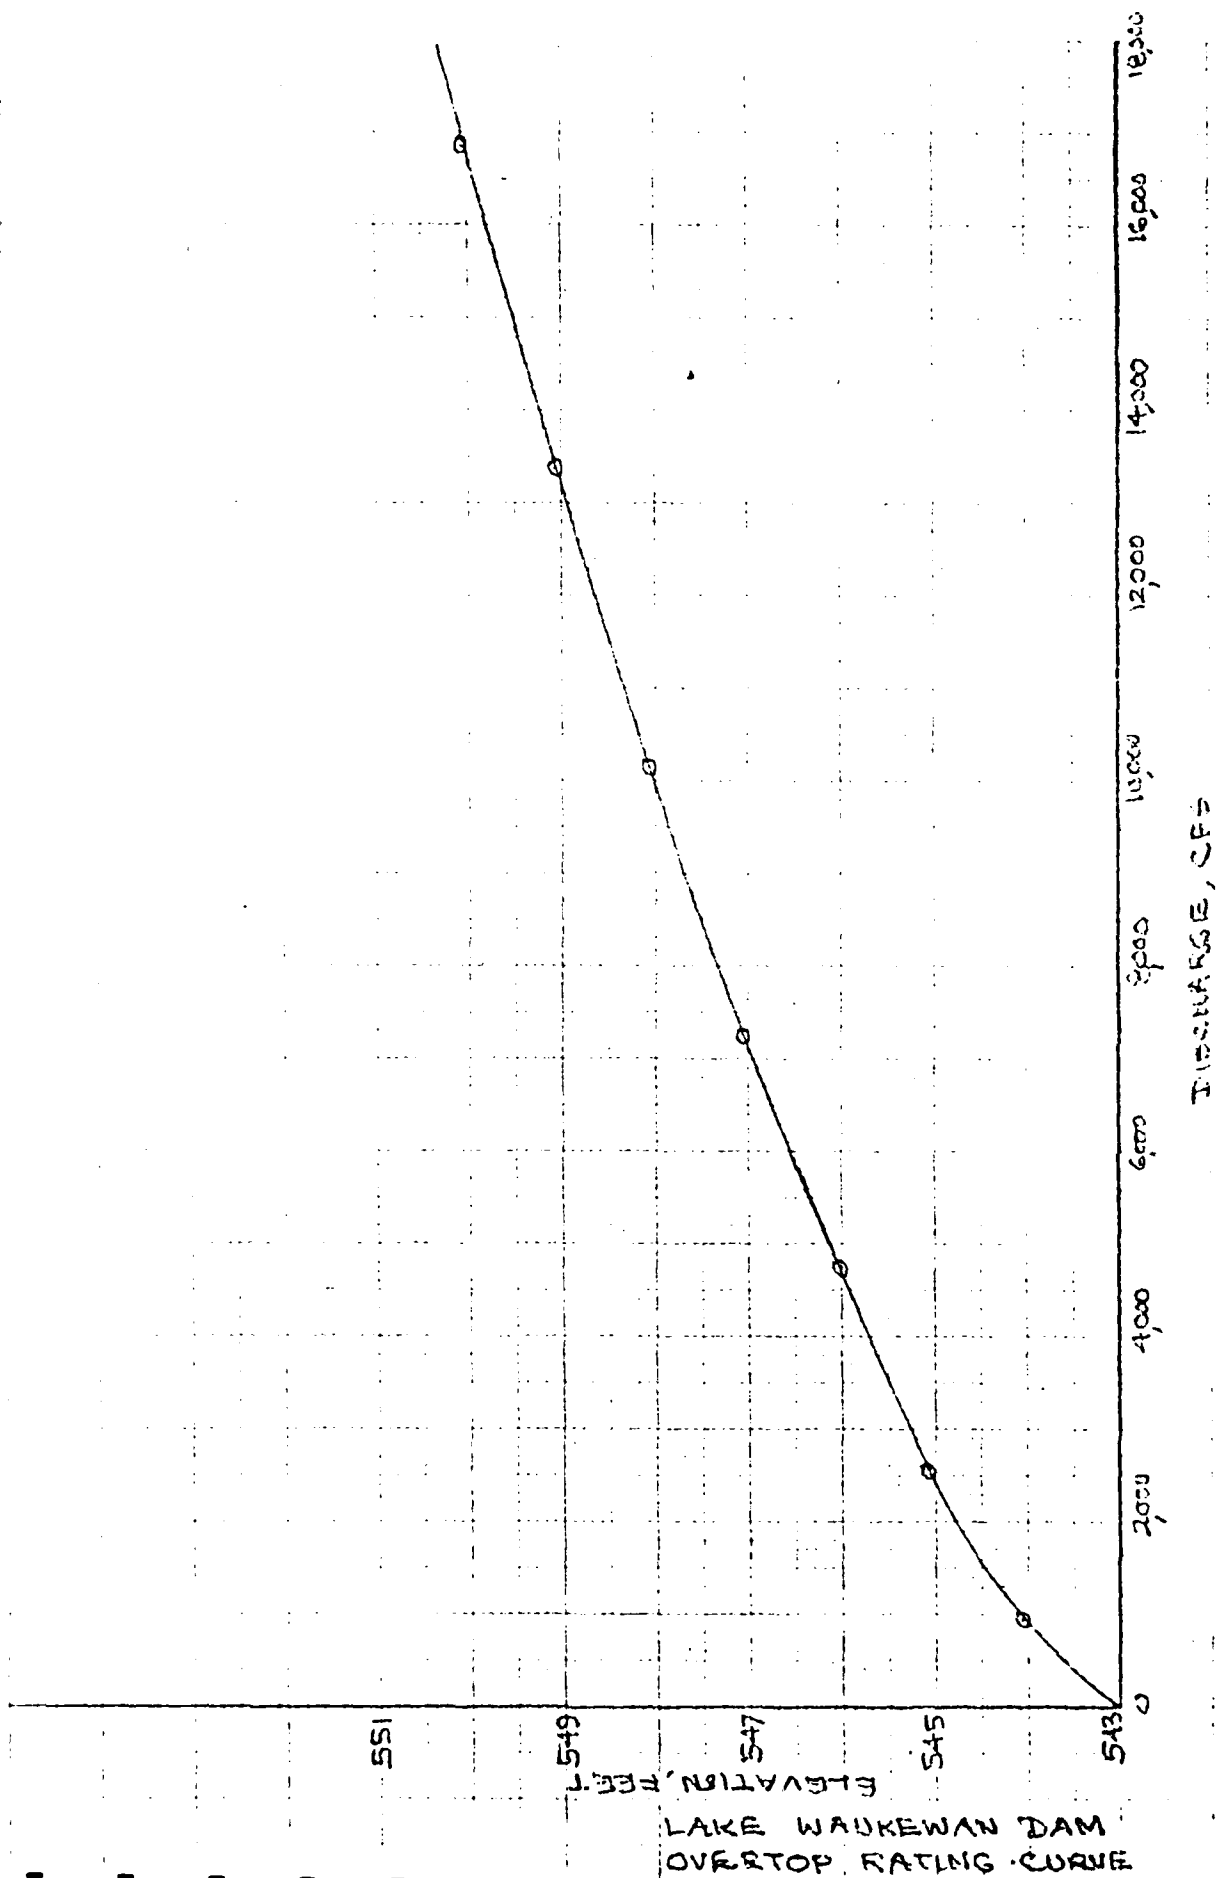

LAKE WAUKEGAN DAM  
OVERTOP RATING CURVE

LAKE WAUKEWAUN DAMMAXIMUM PROBABLE FLOOD PEAK FLOW RATE

ACCORDING TO NED GENERAL CURVE:

ASSUME ROLLING AREA:

$$Q = 2323 - 676.97 \log_{10} A$$

$$A = 12.54 \text{ SQ. MI.}$$

$$\therefore Q = 1579.46 \text{ CFS / SQ. MI.}$$

$$Q_p = A \times Q = 12.54 \times 1579.46 \approx \underline{19806 \text{ CFS}}$$

SINCE PMF RUNOFF IN NEW ENGLAND EQUALS

APPROXIMATELY 19 INCHES ACCORDING

TO NED GUIDELINES.


THE TRIANGULAR SHAPED HYDROGRAPH WILL BE

APPROXIMATED BY THE FOLLOWING SHAPE:

$$\frac{1}{2} T \times Q_p = 19'' \times A$$

$$\therefore T = 2 \left[ \left( \frac{19}{12} \right) \times 12.54 \times 5280^2 \right] / [3600 \times 19806]$$

$$T = 15.53 \text{ HR.}$$

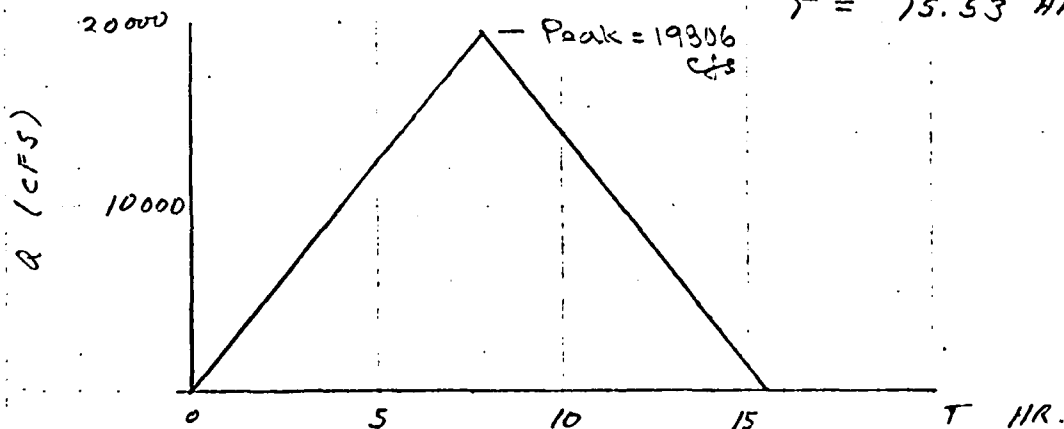



HEC 1 - COMPUTATIONS

DAM SAFETY INSPECTION - NEW HAMPSHIRE

SHEET NO. 1 OF

LAKE WAUKEWAUN DAM

JOB NO. 1211-001-1

INPUT TO HEC-1

BY KLB DATE 8-

INPUT TO HEC-1

#	ELEV (FT)	HEAD ABOVE OVERFLOW SECTION (FT)	Y2 STORAGE (AC-FT)	Y3 DISCHARGE (CFS)
1	539.0 (NORMAL POOL)	-	20500	0.0
2	541.0	-	22450	0.0
3	543.08 (OVER FLOW SEC.)	0.	24200	0.0
4	543.25	0.17	24500	64.0
5	543.50	0.42	24950	247.0
6	544.00	0.92	25500	802.0
7	545.00	1.92	26550	2418.0
8	546.00	2.92	27650	4536.0
9	548.00	4.92	30300	9920.0
10	550.00	6.92	31900.0	16547.0

**\*\*\*\*\***

# JOB SPECIFICATION

NO	NHR	NMIN	IDAY	JOPK	NMI	IMIN	MLTRC	IPLT	IPRT	INSTAN
150	0	15	0	5	0	0	0	0	0	0

1  
 2  
 3  
 4  
 5  
 6  
 7  
 8  
 9  
 10  
 11  
 12  
 13  
 14  
 15  
 16  
 17  
 18  
 19  
 20  
 21  
 22  
 23  
 24  
 25  
 26  
 27  
 28  
 29  
 30  
 31  
 32  
 33  
 34  
 35  
 36  
 37  
 38  
 39  
 40  
 41  
 42  
 43  
 44  
 45  
 46  
 47  
 48  
 49  
 50  
 51  
 52  
 53  
 54  
 55  
 56  
 57  
 58  
 59  
 60  
 61  
 62  
 63  
 64  
 65  
 66  
 67  
 68  
 69  
 70  
 71  
 72  
 73  
 74  
 75  
 76  
 77  
 78  
 79  
 80  
 81  
 82  
 83  
 84  
 85  
 86  
 87  
 88  
 89  
 90  
 91  
 92  
 93  
 94  
 95  
 96  
 97  
 98  
 99  
 100  
 101  
 102  
 103  
 104  
 105  
 106  
 107  
 108  
 109  
 110  
 111  
 112  
 113  
 114  
 115  
 116  
 117  
 118  
 119  
 120  
 121  
 122  
 123  
 124  
 125  
 126  
 127  
 128  
 129  
 130  
 131  
 132  
 133  
 134  
 135  
 136  
 137  
 138  
 139  
 140  
 141  
 142  
 143  
 144  
 145  
 146  
 147  
 148  
 149  
 150  
 151  
 152  
 153  
 154  
 155  
 156  
 157  
 158  
 159  
 160  
 161  
 162  
 163  
 164  
 165  
 166  
 167  
 168  
 169  
 170  
 171  
 172  
 173  
 174  
 175  
 176  
 177  
 178  
 179  
 180  
 181  
 182  
 183  
 184  
 185  
 186  
 187  
 188  
 189  
 190  
 191  
 192  
 193  
 194  
 195  
 196  
 197  
 198  
 199  
 200  
 201  
 202  
 203  
 204  
 205  
 206  
 207  
 208  
 209  
 210  
 211  
 212  
 213  
 214  
 215  
 216  
 217  
 218  
 219  
 220  
 221  
 222  
 223  
 224  
 225  
 226  
 227  
 228  
 229  
 230  
 231  
 232  
 233  
 234  
 235  
 236  
 237  
 238  
 239  
 240  
 241  
 242  
 243  
 244  
 245  
 246  
 247  
 248  
 249  
 250  
 251  
 252  
 253  
 254  
 255  
 256  
 257  
 258  
 259  
 260  
 261  
 262  
 263  
 264  
 265  
 266  
 267  
 268  
 269  
 270  
 271  
 272  
 273  
 274  
 275  
 276  
 277  
 278  
 279  
 280  
 281  
 282  
 283  
 284  
 285  
 286  
 287  
 288  
 289  
 290  
 291  
 292  
 293  
 294  
 295  
 296  
 297  
 298  
 299  
 300  
 301  
 302  
 303  
 304  
 305  
 306  
 307  
 308  
 309  
 310  
 311  
 312  
 313  
 314  
 315  
 316  
 317  
 318  
 319  
 320  
 321  
 322  
 323  
 324  
 325  
 326  
 327  
 328  
 329  
 330  
 331  
 332  
 333  
 334  
 335  
 336  
 337  
 338  
 339  
 340  
 341  
 342  
 343  
 344  
 345  
 346  
 347  
 348  
 349  
 350  
 351  
 352  
 353  
 354  
 355  
 356  
 357  
 358  
 359  
 360  
 361  
 362  
 363  
 364  
 365  
 366  
 367  
 368  
 369  
 370  
 371  
 372  
 373  
 374  
 375  
 376  
 377  
 378  
 379  
 380  
 381  
 382  
 383  
 384  
 385  
 386  
 387  
 388  
 389  
 390  
 391  
 392  
 393  
 394  
 395  
 396  
 397  
 398  
 399  
 400  
 401  
 402  
 403  
 404  
 405  
 406  
 407  
 408  
 409  
 410  
 411  
 412  
 413  
 414  
 415  
 416  
 417  
 418  
 419  
 420  
 421  
 422  
 423  
 424  
 425  
 426  
 427  
 428  
 429  
 430  
 431  
 432  
 433  
 434  
 435  
 436  
 437  
 438  
 439  
 440  
 441  
 442  
 443  
 444  
 445  
 446  
 447  
 448  
 449  
 450  
 451  
 452  
 453  
 454  
 455  
 456  
 457  
 458  
 459  
 460  
 461  
 462  
 463  
 464  
 465  
 466  
 467  
 468  
 469  
 470  
 471  
 472  
 473  
 474  
 475  
 476  
 477  
 478  
 479  
 480  
 481  
 482  
 483  
 484  
 485  
 486  
 487  
 488  
 489  
 490  
 491  
 492  
 493  
 494  
 495  
 496  
 497  
 498  
 499  
 500  
 501  
 502  
 503  
 504  
 505  
 506  
 507  
 508  
 509  
 510  
 511  
 512  
 513  
 514  
 515  
 516  
 517  
 518  
 519  
 520  
 521  
 522  
 523  
 524  
 525

SUB-AREA RUNOFF COMPUTATION

# INPUT TRIANGULAR SHAPE HYDROGRAPH

ISTAO	ICOMP	IECON	IIAPE	JPLI	JPHI	INAME
1	0	0	0	0	0	1

HYDROGRAPH DATA

**LOCAL**

[illegible]

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	19806.	15968.	6394.	4092.	613896.
INCHES		11.84	10.97	18.97	10.97
AC-F		7922.	12690.	12690.	12690.

1  
2  
3  
4  
5  
6  
7  
8  
9  
10  
11  
12  
13  
14  
15  
16  
17  
18  
19  
20  
21  
22  
23  
24  
25  
26  
27  
28  
29  
30  
31  
32  
33  
34  
35  
36  
37  
38  
39  
40  
41  
42  
43  
44  
45  
46  
47  
48  
49  
50  
51  
52  
53  
54  
55  
56  
57  
58  
59  
60  
61  
62  
63  
64  
65  
66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100  
101  
102  
103  
104  
105  
106  
107  
108  
109  
110  
111  
112  
113  
114  
115  
116  
117  
118  
119  
120  
121  
122  
123  
124  
125  
126  
127  
128  
129  
130  
131  
132  
133  
134  
135  
136  
137  
138  
139  
140  
141  
142  
143  
144  
145  
146  
147  
148  
149  
150  
151  
152  
153  
154  
155  
156  
157  
158  
159  
160  
161  
162  
163  
164  
165  
166  
167  
168  
169  
170  
171  
172  
173  
174  
175  
176  
177  
178  
179  
180  
181  
182  
183  
184  
185  
186  
187  
188  
189  
190  
191  
192  
193  
194  
195  
196  
197  
198  
199  
200  
201  
202  
203  
204  
205  
206  
207  
208  
209  
210  
211  
212  
213  
214  
215  
216  
217  
218  
219  
220  
221  
222  
223  
224  
225  
226  
227  
228  
229  
230  
231  
232  
233  
234  
235  
236  
237  
238  
239  
240  
241  
242  
243  
244  
245  
246  
247  
248  
249  
250  
251  
252  
253  
254  
255  
256  
257  
258  
259  
260  
261  
262  
263  
264  
265  
266  
267  
268  
269  
270  
271  
272  
273  
274  
275  
276  
277  
278  
279  
280  
281  
282  
283  
284  
285  
286  
287  
288  
289  
290  
291  
292  
293  
294  
295  
296  
297  
298  
299  
300  
301  
302  
303  
304  
305  
306  
307  
308  
309  
310  
311  
312  
313  
314  
315  
316  
317  
318  
319  
320  
321  
322  
323  
324  
325  
326  
327  
328  
329  
330  
331  
332  
333  
334  
335  
336  
337  
338  
339  
340  
341  
342  
343  
344  
345  
346  
347  
348  
349  
350  
351  
352  
353  
354  
355  
356  
357  
358  
359  
360  
361  
362  
363  
364  
365  
366  
367  
368  
369  
370  
371  
372  
373  
374  
375  
376  
377  
378  
379  
380  
381  
382  
383  
384  
385  
386  
387  
388  
389  
390  
391  
392  
393  
394  
395  
396  
397  
398  
399  
400  
401  
402  
403  
404  
405  
406  
407  
408  
409  
410  
411  
412  
413  
414  
415  
416  
417  
418  
419  
420  
421  
422  
423  
424  
425  
426  
427  
428  
429  
430  
431  
432  
433  
434  
435  
436  
437  
438  
439  
440  
441  
442  
443  
444  
445  
446  
447  
448  
449  
450  
451  
452  
453  
454  
455  
456  
457  
458  
459  
460  
461  
462  
463  
464  
465  
466  
467  
468  
469  
470  
471  
472  
473  
474  
475  
476  
477  
478  
479  
480  
481  
482  
483  
484  
485  
486  
487  
488  
489  
490  
491  
492  
493  
494  
495  
496  
497  
498  
499  
500  
501  
502  
503  
504  
505  
506  
507  
508  
509  
510  
511  
512  
513  
514  
515  
516  
517  
518  
519  
520  
521  
522  
523  
524  
525  
526  
527  
528  
529  
530  
531  
532  
533  
534  
535  
536  
537  
538  
539  
540  
541  
542  
543  
544  
545  
546  
547  
548  
549  
550  
551  
552  
553  
554  
555  
556  
557  
558  
559  
560  
561  
562  
563  
564  
565  
566  
567  
568  
569  
570  
571  
572  
573  
574  
575  
576  
577  
578  
579  
580  
581  
582  
583  
584  
585  
586  
587  
588  
589  
590  
591  
592  
593  
594  
595  
596  
597  
598  
599  
600  
601  
602  
603  
604  
605  
606  
607  
608  
609  
610  
611  
612  
613  
614  
615  
616  
617  
618  
619  
620  
621  
622  
623  
624  
625  
626  
627  
628  
629  
630  
631  
632  
633  
634  
635  
636  
637  
638  
639  
640  
641  
642  
643  
644  
645  
646  
647  
648  
649  
650  
651  
652  
653  
654  
655  
656  
657  
658  
659  
660  
661  
662  
663  
664  
665  
666  
667  
668  
669  
670  
671  
672  
673  
674  
675  
676  
677  
678  
679  
680  
681  
682  
683  
684  
685  
686  
687  
688  
689  
690  
691  
692  
693  
694  
695  
696  
697  
698  
699  
700  
701  
702  
703  
704  
705  
706  
707  
708  
709  
710  
711  
712  
713  
714  
715  
716  
717  
718  
719  
720  
721  
722  
723  
724  
725  
726  
727  
728  
729  
730  
731  
732  
733  
734  
735  
736  
737  
738  
739  
740  
741  
742  
743  
744  
745  
746  
747  
748  
749  
750  
751  
752  
753  
754  
755  
756  
757  
758  
759  
760  
761  
762  
763  
764  
765  
766  
767  
768  
769  
770  
771  
772  
773  
774  
775  
776  
777  
778  
779  
780  
781  
782  
783  
784  
785  
786  
787  
788  
789  
790  
791  
792  
793  
794  
795  
796  
797  
798  
799  
800  
801  
802  
803  
804  
805  
806  
807  
808  
809  
810  
811  
812  
813  
814  
815  
816  
817  
818  
819  
820  
821  
822  
823  
824  
825  
826  
827  
828  
829  
830  
831  
832  
833  
834  
835  
836  
837  
838  
839  
840  
84

## HYDROGRAPH ROUTING

# ROUTE HYDROGRAPH THROUGH LAKE WAUKEMAN DAM

ISTAO 4, ICOMP 1, IECUN 0, IIAPE 0, JPLT 2, JPRT 0, INAME 1

GLUSS 0.0, CLOSS 0.000, LAG 0, AMSKK 0.000, X 0.000, STORA -1.

ROUTING DATA  
AVG IRES ISAME

STORAGE= 20500. 22450. 24200. 24500. 24950. 25500. 26550. 27650. 30300. 31900.  
OUTFLOW= 0. 0. 0. 64. 247. 602. 2418. 4356. 9920. 16547.

TIME	FOR	SION	AVG IN	LOP	OUT
1	22450.	0.	0.	0.	0.
2	22456.	319.	0.	0.	0.
3	22476.	956.	0.	0.	0.
4	22509.	1597.	0.	0.	0.
5	22555.	2256.	0.	0.	0.
6	22615.	2875.	0.	0.	0.
7	22687.	3514.	0.	0.	0.
8	22773.	4152.	0.	0.	0.
9	22872.	4791.	0.	0.	0.
10	22984.	5430.	0.	0.	0.
11	23110.	6069.	0.	0.	0.
12	23248.	6708.	0.	0.	0.
13	23400.	7347.	0.	0.	0.
14	23565.	7986.	0.	0.	0.
15	23743.	8625.	0.	0.	0.
16	23935.	9264.	0.	0.	0.
17	24139.	9903.	0.	0.	0.
18	24357.	10541.	33.	33.	33.
19	24586.	11180.	99.	99.	99.
20	24827.	11819.	197.	197.	197.
21	25079.	12458.	377.	377.	377.
22	25339.	13097.	640.	640.	640.
23	25611.	13761.	973.	973.	973.
24	25888.	14600.	1399.	1399.	1399.
25	26165.	15014.	1625.	1625.	1625.
26	26446.	15653.	2258.	2258.	2258.
27	26731.	16292.	2757.	2757.	2757.
28	27019.	16930.	3245.	3245.	3245.
29	27310.	17569.	3737.	3737.	3737.
30	27600.	18213.	4269.	4269.	4269.
31	27892.	18712.	4866.	4866.	4866.
32	28186.	19486.	5136.	5136.	5136.
33	28471.	19481.	6001.	6001.	6001.
34	28727.	16712.	6617.	6617.	6617.
35	28958.	18075.	7103.	7103.	7103.
36	29170.	17569.	7548.	7548.	7548.
37	29360.	16930.	7946.	7946.	7946.
38	29528.	16292.	8300.	8300.	8300.
39	29677.	15653.	8613.	8613.	8613.
40	29807.	15014.	8804.	8804.	8804.
41	29918.	14375.	9118.	9118.	9118.
42	30011.	13736.	9314.	9314.	9314.
43	30087.	13097.	9474.	9474.	9474.
44	30148.	12458.	9601.	9601.	9601.
45	30195.	11819.	9695.	9695.	9695.
46	30223.	11180.	9750.	9750.	9750.

47	30239.	10501.	9791.
48	30241.	9903.	9796.
49	30230.	9204.	9774.
50	30207.	8625.	9725.
51	30172.	7986.	9651.
52	30125.	7347.	9553.
53	30067.	6706.	9432.
54	29999.	6069.	9289.
55	29921.	5430.	9126.
56	29834.	4791.	8942.
57	29757.	4132.	8738.
58	29651.	3514.	8516.
59	29517.	2875.	8277.
60	29395.	2236.	8020.
61	29265.	1597.	7748.
62	29128.	958.	7459.
63	28983.	313.	7156.
64	28839.	0.	6832.
65	28700.	0.	6561.
66	28567.	0.	6283.
67	28440.	0.	6016.
68	28319.	0.	5760.
69	28202.	0.	5516.
70	28091.	0.	5282.
71	27984.	0.	5057.
72	27881.	0.	4843.
73	27784.	0.	4637.
74	27690.	0.	4440.
75	27600.	0.	4268.
76	27513.	0.	4115.
77	27430.	0.	3968.
78	27349.	0.	3826.
79	27271.	0.	3689.
80	27197.	0.	3558.
81	27124.	0.	3430.
82	27055.	0.	3308.
83	26988.	0.	3189.
84	26923.	0.	3075.
85	26860.	0.	2965.
86	26800.	0.	2859.
87	26742.	0.	2757.
88	26686.	0.	2658.
89	26632.	0.	2563.
90	26580.	0.	2472.
91	26530.	0.	2388.
92	26482.	0.	2313.
93	26434.	0.	2240.
94	26389.	0.	2170.
95	26345.	0.	2102.
96	26302.	0.	2037.
97	26261.	0.	1973.
98	26220.	0.	1911.
99	26182.	0.	1851.
100	26144.	0.	1793.
101	26107.	0.	1737.
102	26072.	0.	1683.
103	26030.	0.	1630.
104	26005.	0.	1579.
105	25973.	0.	1529.
106	25941.	0.	1482.
107	25911.	0.	1435.

1001 SOUTH NAVARRE, DE BEVERLY, CALIFORNIA 90223

108	25802.	0.	1390.
109	25804.	0.	1347.
110	25806.	0.	1303.
111	25808.	0.	1264.
112	25774.	0.	1224.
113	25749.	0.	1186.
114	25725.	0.	1149.
115	25702.	0.	1113.
116	25679.	0.	1078.
117	25657.	0.	1044.
118	25636.	0.	1011.
119	25615.	0.	980.
120	25595.	0.	949.
121	25576.	0.	919.
122	25557.	0.	890.
123	25539.	0.	863.
124	25522.	0.	836.
125	25505.	0.	809.
126	25480.	0.	790.
127	25472.	0.	774.
128	25456.	0.	758.
129	25441.	0.	742.
130	25425.	0.	727.
131	25411.	0.	712.
132	25396.	0.	697.
133	25382.	0.	683.
134	25368.	0.	669.
135	25354.	0.	655.
136	25341.	0.	641.
137	25328.	0.	628.
138	25315.	0.	615.
139	25302.	0.	602.
140	25290.	0.	590.
141	25278.	0.	578.
142	25266.	0.	566.
143	25254.	0.	554.
144	25243.	0.	543.
145	25232.	0.	531.
146	25221.	0.	520.
147	25210.	0.	510.
148	25200.	0.	499.
149	25190.	0.	489.
150	25180.	0.	479.

481976.

TOTAL VOLUME  
481976.  
14.89  
9963.72-HOUR  
3213.  
14.89  
9963.24-HOUR  
4779.  
14.18  
9484.6-HOUR  
9139.  
6.77  
4534.PEAK  
9796.CFS  
INCHES  
AC-FT

SUM

RUNOFF SUMMARY, AVERAGE FLOW

HYDROGRAPH AT ROUTED TO	4	4	PEAK	AVERAGE FLOW		AREA
				6-HOUR	24-HOUR	
			19806.	15968.	6394.	12.54
			9796.	9139.	4779.	12.54
					4092.	
					3213.	

U.S. GEOLOGICAL SURVEY, WATER RESOURCES DIVISION

